

SciAps HH-LIBS Analyzers

Z900 Series User Manual

V1.0 March 2021



SciAps

Contents

1.	Contact Information:	4
2.	Technology	5
3.	What's in the Box?	6
4.	Analyzer Overview	7
5.	Safety	8
(General Safety Warnings	8
I	Battery Safety	8
I	Laser Safety	8
,	Argon Safety	8
6.	Model Overview	9
7.	Start Up & User Interface	9
8.	Calibration	18
,	Wavelength Calibration	18
I	Drift Correction	21
-	Type Standardization	29
9.	Sample Preparation	33
10	Alloy(+) Mode	34
,	Alloy(+) Mode Overview	34
I	Element Suite	34
-	Taking a Test	35
-	Test Setup	42
I	Display Preferences	44
-	Test Info Fields	48
11.	QuickSort(+) Mode	52
(QuickSort(+) Mode Overview	52
I	Element Suite	52
-	Taking a Test	54
-	Test Setup	60
I	Display Preferences	62
-	Test Info Fields	66
12.	. Carbon(+) Mode	70
(Carbon(+) Mode Overview	70

Ele	ement Suite	71
Та	king a Test	71
Те	st Setup	80
Dis	splay Preferences	83
Те	est Info Fields	87
Fo	ormulas	92
13.	Pipeline Mode	93
14.	Results	96
Na	avigating Results	96
Da	ata Management	100
	Exporting Results	102
15.	Analytical Settings	107
Fo	arce Base	107
Ad	ljust User Factors	110
16.	Formulas	115
17.	System Features	120
Blu	uetooth	120
Wi	i-Fi	122
US	SB Connectivity	124
Us	ser Management	125
18.	Instrument Ownership	129
Ma	aintenance	129
	Quartz Blast Shield	129
	Argon	130
	Li-Ion Batteries	130
Sto	orage & Transportation	130
So	ftware Updates	130
Appe	endix: Default Acquisition Settings	133
Appe	endix: Grade Library Management	134
Appe	endix: Sample PDF Report	135


1. Contact Information:

SciAps, Inc. Global Headquarters 7 Constitution Way, Woburn MA 01801 Phone: +1 339-927-9455 Sales: <u>sales@sciaps.com</u>

Support: support@sciaps.com

2. Technology


The Z is a handheld analyzer utilizing Laser Induced Breakdown Spectroscopy (LIBS), a type of atomic optical emission spectroscopy (OES). Since the early 19th century, scientists have known that elements emit specific colors of light. This combination of colors is a unique signature for each element. The wavelength (color) of specific lines reveals the elements present, and the intensity of the light at a given wavelength is related to the concentration of each element. Traditional OES has used sparks and flames to generate a plasma. The invention and recent developments of laser technology allow lasers to be used instead. This gives more precise control over the plasma formation. Unlike sparks and flames, the laser can generate plasmas on the surface of non-conducting, unprepared samples, like soils, rocks, or liquids.

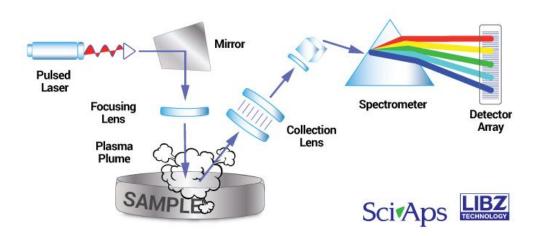

Sample analysis is broken down into five steps (fig 2.1):


- 1. A high energy pulsed laser is focused on the sample. The high temperature of the laser on the sample results in ablation of a small volume of material (roughly 25 um: less than the thickness of a dollar bill) in plasma plume. The plasma contains the sample's excited atoms and ions.
- 2. As the plasma starts to cool, the electrons of the excited atoms and ions fall back down to their ground states. As they return to their ground states, light of specific wavelengths is emitted from the plasma and collected by the spectrometer.
- 3. The spectrometer separates all light emissions with high resolution optics to be detected by the charge-coupled device (CCD).
- 4. The elements detected in the sample can be viewed in a graph or spectrum. The graph charts the intensity of the emitted light as a function of the wavelength.
- 5. An on-board processor compares the height of specific peaks to a calibration. The calibrations are built by testing a series of Certified Reference Materials (standards of known chemical composition). This provides quantitative chemical results. Calibrations are added at the factory, or operators can create their own calibration routines.

3. What's in the Box?

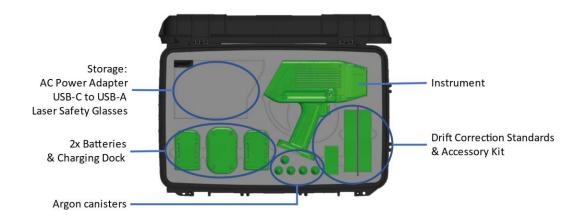

- 1) 1x Hard Sided Instrument Case
- 2) 1x Instrument with W rist L anyard
- 3) 2x Li-ion B atteries
- 4) 1x Battery Charging Dock
- 5) 1x AC Power Adapter
- 6) 1x USB-C to USB-A C able
- 7) 1x Laser Safety Glasses OD 5+ for 1064 nm L aser
- 8) Accessory Kit:
 - a. 1x M2 Allen Wrench
 - b. 2x Replacement Splatter Shield
 - c. 1x USB Drive; with Calibration Certificate
 - d. Digital C opy of I nstrument M anual
 - e. Profile Builder Desktop Software (if included)
- 9) Drift Correction Standards (configuration specific)
- 10) 5x Argon Cylinders (applicable models only)

4. Analyzer Overview

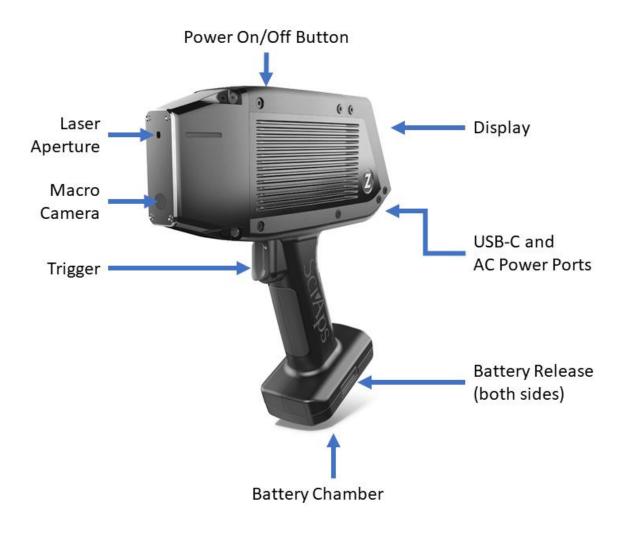

5. Safety

General Safety Warnings





The main compartment contains high voltage electronics. Opening the main compartment will void the warranty and could potentially be hazardous to a user.

Do not attempt to service the Z. If there is a malfunction, contact the factory for assistance. Users may replace batteries, change the argon cylinder, and replace the analyzer window, but all other maintenance and repair procedures must be done with factory support or at the factory.



If the Z is damaged, do not attempt to operate it. Contact the factory for service.



Ensure that the correct external power source is used for operating the analyzer or charging the battery. Voltage should be (100V-240 V/ 50-60 Hz). Do not overload an electrical outlet.

Battery Safety

The Z-900 uses a 14.4V Li ion rechargeable battery pack. Care should be taken with this battery. Avoid shorting it. Do not immerse it in water. Store in a cool, dry, and well-ventilated area. Avoid excessive physical shock or vibration. Do not dispose of battery in fire.



Never use a damaged battery.

Only charge batteries in the approved charger or in the analyzer. Never use a modified or damaged charger.

Laser Safety

All Z-900 Series models use an embedded CLASS 3B laser per requirements of the US Federal Laser Product Performance Standard (FLPPS) contained in the regulations in 21 CFR Subchapter J except for deviations specific to Notices issued by the Department of Health and Human Services including Laser Notice No. 50, dated June 24, 2007. The maximum pulsed laser output is 7.5 mJ (50 Hz, 1064 nm).

The Nominal Ocular Hazard Distance (NOHD) describes the distance from the aperture where the laser can be hazardous to the eye. For the Z-900 Series, a 1064nm Nd Yag laser, the NOHD for a 10 second maximum permissible exposure (1.5mW/cm2) is 13.0 m.

The Z-900 Series uses fail-safe interlocks to function as engineering features to prevent the laser from being fired without a sample present. With these engineering features active, the system may be used as a CLASS 1M system following local Laser Safety Officer (LSO) approval.

Care should be taken to operate the instrument safely. Laser safety training is required for all operators. Laser safety goggles with an optical density of 5+ @850-1080 nm are recommended but not required. Extra laser safety goggles may be purchased through SciAps.

Argon Safety



Argon is an inert gas and not flammable, however, the heat of a fire can build pressure in the cylinder and cause it to rupture. Do not expose the cylinder to extreme heat, or dispose of it in a fire. Recommended storage temperature: $-30^{\circ}C - 65^{\circ}C$.

Model	Configuration	Bases
Z-901	QuickSort	Al, Ti, Fe, SS, Ni, Cu, Co, Pures (airburn)
Z-901	Alloy	Al, Ti, Fe, SS, Ni, Cu, Co, Pures (argon)
Z-901	Dual Burn	Al, Ti, Fe, SS, Ni, Cu, Co, Pures (airburn) Al, Ti, Fe, SS, Ni, Cu, Co, Pures (argon)
Z-901	CSi	Fe(C, Si), Stainless (C)
Z-902	QuickSort+	Al, Ti, Fe, SS, Ni, Cu, Co, Pures (airburn)
Z-902	Alloy+	Al, Ti, Fe, SS, Ni, Cu, Co, Pures (argon)
Z-902	Dual Burn+	Al, Ti, Fe, SS, Ni, Cu, Co, Pures (airburn) Al, Ti, Fe, SS, Ni, Cu, Co, Pures (argon)
Z-902	Carbon	Fe+C, Stainless+C
Z-902	Carbon PREMIUM	Fe+C, Stainless+C, Al, Ti,, Ni, Cu, Co, Pures (argon)
Z-903	QuickSort+	Al, Ti, Fe, SS, Ni, Cu, Co, Pures (airburn)
Z-903	Alloy+	Al, Ti, Fe, SS, Ni, Cu, Co, Pures (argon)
Z-903	Carbon+	Fe+C, Stainless+C,
Z-903	Carbon+ PREMIUM	Fe+C, Stainless+C, Al, Ti,, Ni, Cu, Co, Pures (argon)
Z-903	Geo	Coming Fall 2021
Z-903	Empirical	Coming Fall 2021

6. Model Overview

7. Start Up & User Interface

Inserting the battery

Batteries should be charged before use. A full charge cycle takes approximately 3 hours. Insert the keyed Li-ion battery into the handle of the instrument.

Note: The tapered end of the battery should face towards the nose of the instrument.



Inserting Argon

Screw argon canister into regulator on side of instrument clock-wise. The regulator will pierce the single-use canister seal. Do not remove argon canister until the system reports that the canister is empty.

Each canister has enough argon for approximately 600 tests (varies with acquisition settings and averaged results).

Note 1 – Specific, c arbon-grade argon is required for accurate carbon analysis. Note 2 – Argon canisters are single use and cannot be refilled.

Do not remove canisters that are still under pressure as it will cause premature deterioration of the regulator gasket.



Powering on the system


Firmly press and release the power button on the top of the analyzer. LED Indicator Light: OFF = Off GREEN = On, laser has not been fired RED = On, laser armed and ready to fire

To shut down the system, firmly press and hold the power button for 3 seconds then release.

When prompted, select Power Off. Wait for the LED light to turn off before removing the battery.

If required, hold the power button for 12 seconds to perform a hard shutdown.



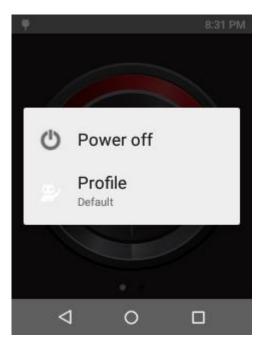


System Login

After the analyzer starts, you will need to login.

The default account is **admin.**

Simply press the > icon to continue.

Additional accounts may be generated when logged into the account.

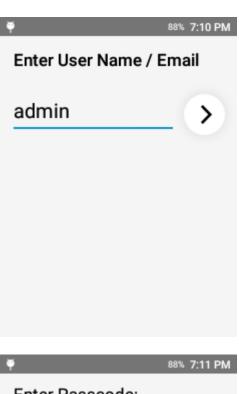

The Admin passcode is **1 2 3 4 5**

Enter Passcode:						
< · · · · ·						
1 2 3						
4	5	6				
7	8	9				
• 0 •						

Laser Safety Warning Message

After entering the passcode, you must accept the laser safety warning message to continue. Use should be limited to trained operators only.

The Z-900 Series analyzer utilizes an embedded Class 3B laser with engineering features to function as an interlock. This combination, with local Laser Safety Officer approval, allows the system to be operated under Class 1M conditions.

Operation should be limited to trained operators only, and the instrument should be controlled at all times.

Launch Screen


Features 3 primary functions:

- Analyze
- Settings
- Results


Analyze is used for all analytical testing and data collection.

Settings controls the analyzer settings. There are additional settings in the Android Settings menu.

Results allows the user to view, review, export, and manage previously captured data.

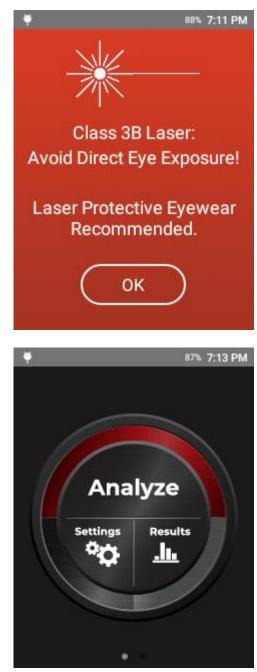

Swipe left to show additional features and options.

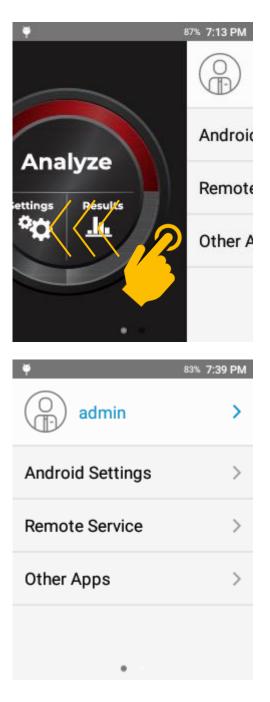

Additional options include:

User Management: change password, manage users

Android Settings: Access WiFi settings, Date and Time, and other non-analytical system settings Other Apps: Includes SciAps Updater, and 3rd party apps such as Email or Contacts

Navigation Bar


Swiping up from the bottom will show the navigation bar. In this bar, there are 3 options: Back Home Open Apps

Back simply returns you to the previous screen.

Home returns you to the SciAps launch screen.

Open Apps shows all apps that are actively running. This allows the user to quickly switch between open apps or to close an app by swiping the app icon in this view.

To start testing – select "Analyze" and select an app.

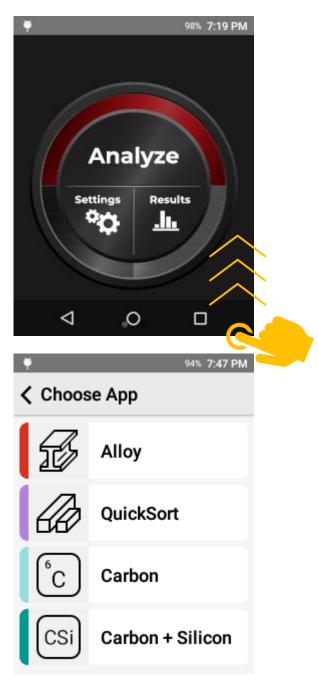


Warm Up

The Z-900 Series has an optimal internal temperature between 25° C and 40° C.

When an app is opened, if the internal temperature is below 26° C, the system will prompt for WARM UP. Simply pull the trigger or tap Warm Up to continue.

In temperatures outside of the recommended operation range, additional measures may be required for optimal operation (e.g. reduced duty cycle in high ambient temperatures).

By default, the system will run a 60 second warm up cycle. The system does not emit any laser pulses during warm up. A sample is not required for warm up.

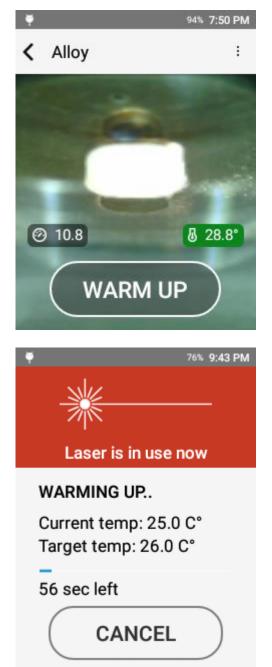

Repeat Warm Up

If the system does not reach the target temperature before the cycle is completed, the system will prompt the operator that the minimum recommended operating temperature has not been reached.

Warm up will repeat the protocol.


Cancel will take the operator to the testing screen.

Factory recommendation is to repeat Warm Up until the target temperature is reached. This is when the instrument is being operated in the recommended ambient temperature range.

Wavelength Calibration

When the analyzer reaches the target temperature, the system will prompt for a wavelength calibration.

This is indicated by the text "CALIBRATE" on the button at the bottom of the screen.

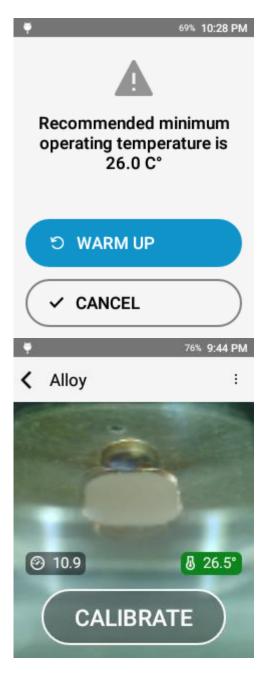

Wavelength Calibration

When prompted to calibrate, simply tap the onscreen "CALIBRATE" button or pull the trigger.

The system will shoot an internal standard. No sample is required for Wavelength Calibration.

Wavelength Calibration corrects for any wavelength drift in the spectrometer. Typically, a Wavelength Calibration is recommended every time the instrument is started, every four (4) hours of use, or when the internal temperature changes more than 7° C.

The instrument monitors time and temperature for these changes.


After the WL Calibration is complete, the button will read START. This indicates that the instrument is ready for testing.


When the instrument is ready:

If equipped, argon pressure will be indicated in the bottom left corner of the screen. It will typically be between 10 and 12 PSI.

② 11.5

Internal instrument temperature will be indicated in the bottom right corner of the screen. Ideal operating temperature is between 25° and 40° C.

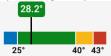

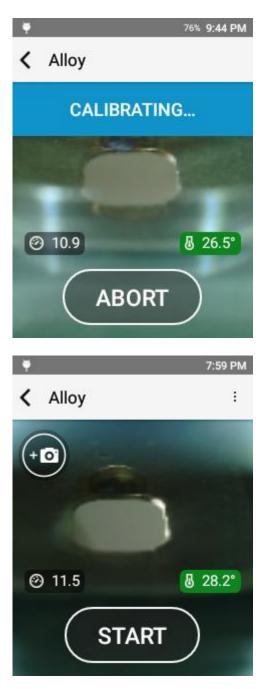

To take a test, pull the trigger or press the start button.

Be sure to hold the sample flush to the laser aperture and keep the sample still for the entire test.

<u>Result</u>

Comprised of 6 primary components:

- 1. Test Number
- 2. Grade Match
- 3. Chemistry
- 4. Grade Compare
- 5. Camera
- 6. Test Info

Grade Match indicates the top match for the measured chemistry compared to the instrument grade library. The Grade Match Score indicates the quality of the match. A score of 100 is considered a perfect match, meaning that all measured elements matching the alloy are calculated by determining if each specified element is in the specified range for the grade. If it is out of range, a penalty is calculated based on how far each element is out of range. The calculated penalty for each element is summed then subtracted from 100.

56% 3:32 PM #5 6061 100 < TESTING... 0.913% ± 0.158% 0.80 Mg ± 0.355% 93.6 AI 97.38% Si 0.503% ± 0.008% 0.40 Cr 0.091% ± 0.006% 0.04 ± 0.013% 0.00 Mn 0.088% ± 0.014% 0.00 Fe 0.577% 56% 3:34 PM **〈** #5 6061 ¹⁰⁰ ÷ 0 0 1.01% ± 0.091% 0.80 Mg AI 97.35% ± 0.351% 93.6 Si 0.596% ± 0.064% 0.40 ± 0.007% 0.04 Cr 0.095% Mn 0.096% ± 0.008% 0.00 Fe 0.481% ± 0.110% 0.00

8. Calibration


Wavelength Calibration

Wavelength Calibrations are standard and recommended practice for the SciAps Z-900 Series. This procedure verifies that the unit is operating properly and ensures that the wavelength scale is correct.


When a wavelength calibration is performed, the analyzer will fire the laser on a piece of metal inside the laser. No sample is required for a Wavelength Calibration. The image will be visible on the screen. When the procedure is complete, a message will appear on the screen indicating success.

When a Wavelength Calibration is required, the START button will read CALIBRATE. Simply tap CALIBRATE or pull the trigger to start the Wavelength Calibration process. The process is fully automated.

During Wavelength Calibration, the laser and LED Spotlight will move to the top of the aperture and fire a series of laser pulses. The test status bar will read CALIBRATING...

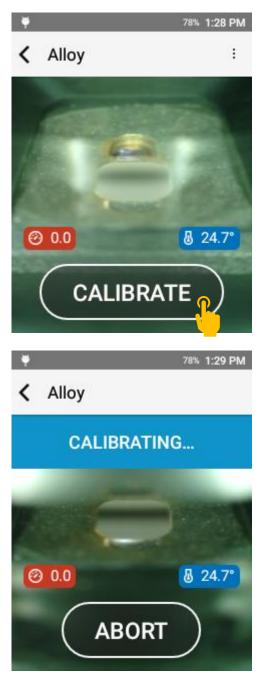

If the Wavelength Calibration is successful, the test status bar will read COMPLETED.

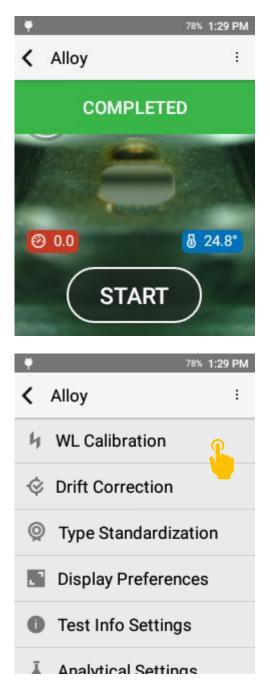

Manual Wavelength Calibration


Can be performed by opening the options menu and selecting WL Calibration.

Wavelength Calibration Failure

In the event of a failure, the system will prompt: Attention: WL Calibration Failed followed by a specific error message.

Please contact SciAps Support if the WL Calibration fails.

- Basic Troubleshooting steps:
 - 1. Repeat WL Calibration.
 - 2. Confirm that the instrument is in the proper operating temperature range.
 - 3. Remove nose plate and clean the quartz blast shield with a cotton swab.
 - 4. Remove nose plate and clean the area directly above the aperture with a cotton swab.

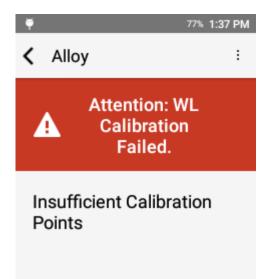

Drift Correction

Similar to all Optical Emission Spectroscopy techniques, the Z-900 Series analyzers can experience spectrometer drift due to temperature changes or other environmental and physical effects. Intensity Drift can be corrected through the Drift Correction feature described below.

It is recommended that users test known check standards as part of their standard operating procedure. If the instrument does not perform as expected on the check standards, then a Drift Correction can be applied to correct for spectrometer drift.

Drift correction requires the specific set of drift correction standards that was delivered with the instrument. Open the Drift Correction feature found in the three dots menu of the target testing app. Follow the steps below to complete a drift correction.

Note – drift correction is specific to the testing mode.

Prior to Drift Correction, SciAps recommends:


- 1. Cleaning the Quartz blast shield with a cotton swab
- 2. Performing a Wavelength Calibration

For Drift Correction in Carbon(+), Carbon+Silicon, and Pipeline, proper sample preparation is required prior to drift correction.

Access Drift Correction from the testing mode options menu.

All available bases for drift correction will be listed in the following screen.

Tap a base to perform a drift correction for that base.

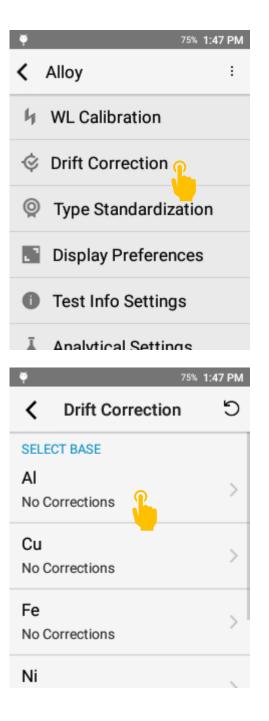

Some bases contain four standards. Simply scroll down to see the additional standards.

To clear all drift correction values, tap the reset button in the top corner of the drift correction menu.

	i i i i i i i i i i i i i i i i i i i	75% 1:47 PM
<	AI	5
	3_8 Corrections	
	01_4 Corrections	\sim
705	60_2 Corrections	
	Start Correction	
T C	· · · · · · · · · · · · · · · · · · ·	75% 1:47 PM
<	Drift Correction	/5% 1:47 PM
•		/5% 1:47 PM
•	Drift Correction	/5% 1:47 PM
SELE	Drift Correction	5% 1:47 PM
SELE	Drift Correction	5% 1:47 PM
SELE Al No C	Drift Correction	/5% 1:47 PM
SELE Al No C	Drift Correction	/5% 1:47 PM
SELE Al No C Cu No C	Drift Correction	/5% 1:47 PM
SELE Al No C Cu No C	Drift Correction CCT BASE Corrections	/5% 1:47 PM

Then accept the prompt by tapping Reset Values.


75% 1:47 PM

Keset Values

All Drift Correction values for all Bases will be reset to their original values:


Factor = 1, Offset = 0

To reset drift correction values for a specific base, open that base then tap the reset button.

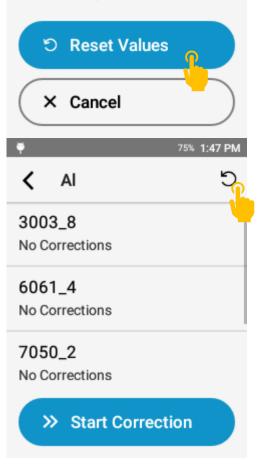

Then accept the prompt by tapping Reset Values.

This will not reset values for any other base.

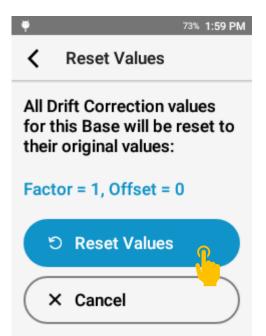

5

This automated drift correction procedure calculates factors and offsets for elements within the base.

A factor is typically used for higher concentration elements.

An offset is typically used for lower concentration elements. To drift correct the Aluminum base, select 72% 2:08 PM aluminum from the main drift correction menu. < AI Tap a drift correction sample to select that sample. 3003_8 No Corrections 6061_4 No Corrections 7050_2 No Corrections >> Start Correction

Hold the specific sample – confirming that both the alloy (e.g. 3003) and the batch (e.g. 8) match between the standard and the on screen display – to the aperture.

Tap the START button or pull the trigger to start the sequence.

In Alloy(+) and Quick Sort(+) mode, the system will run 3 tests.


In Carbon+Silicon, Carbon(+), and Pipeline, the system will run a Pre-Burn as set in the Acquisition Settings menu then a series of 3 tests

When testing, the test status bar will indicate progress through the drift correction procedure.

For Aluminum and Copper bases, SciAps recommends moving the sample between laser bursts.


For all other bases, SciAps recommends leaving the sample in the same location for all laser bursts.

For Carbon based modes (C+Si, Carbon(+), Pipeline), the sample must stay in the same location for all tests.

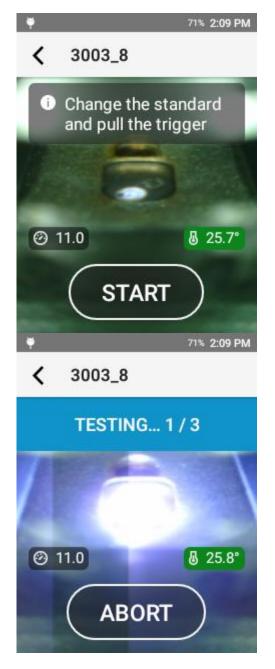

When a standard is complete, the system will return to the standard selection screen. The standard will be updated with a blue check mark and a time and date stamp.

Tap the next standard in the list to continue the process.

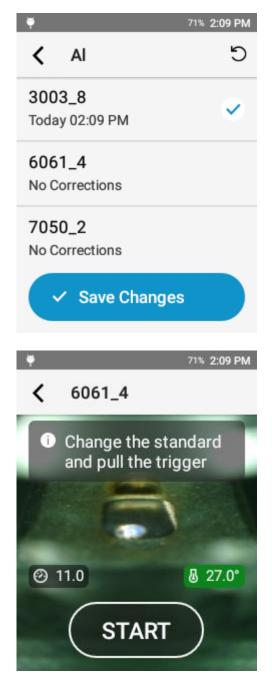

When all standards in the list have a blue check mark, tap Save Changes. If you exit without saving changes, the correction values will not be saved or applied to the chemistry.

After saving changes, the time and date stamp will be updated for that base.

There is an internal check on the factors to confirm that they are reasonable values. If a standard is out of range, the system will prompt the user.

In the event of an Out of Range message, confirm:

- 1. The correct standard was shot
- 2. The standard is clean
- 3. The blast shield is clean
- 4. Instrument temperature is in the normal operating range
- 5. If Argon is required, the canister did not become empty during the test

If all of these basic criteria were met, reshoot the standard. If the same out of range error is produced, apply the factors and continue drift correction. When the drift correction process is complete, validate performance with a check standard. If the chemistry is out of range, it may be indicative of a hardware issue. In this case, please contact SciAps Support for assistance. Drift Correction Standards Aluminum Base

Copper Base

Iron Base

Stainless Base (Alloy*, QuickSort*)

Stainless Base (Carbon*)

Nickel Base

71% 2:10 PM < 6061_4 Out of Range А Apply ී Reshoot AI factor -36.2Mg 22.9 factor Cr Si factor 3.00

Bases and standards are model and mode specific 3003 6061 7050 356 CDA 715 CDA 836 CDA 863 CP Iron 1030 8620 LAS1 317L Custom 455 C350 Nitronic 60 316L 304 347H

Type Standardization

Type Standardization is a single point calibration that allows users to automatically adjust the calibration to match a particular Reference Material or Certified Reference Material. The Type Standardization will adjust the slope or offset each element's calibration curve so that the result will match the assay of


Inconel 625 Rene 41 the standard. The slope is adjusted for high concentrations, and the offset is adjusted for trace levels. Typically, the cutoff for slope versus offset is 0.2%.

Type Standardization should be used for improved accuracy on a small sample range when the chemistry of the reference material, aka the Type Standard, is very similar to the material to be tested.

In order to perform a Type Standardization, you must have a Reference Material (RM) or Certified Reference Material (CRM) entered into the system. To enter an RM or CRM, connect to the database in Profile Builder, access the standards page, add your standard with assay values and designate the standard for Type Standardization.

Type Standardization Setup * 40% 9:49 PM Carbon ÷ < To access Type Standardization, open the options menu and tap Type Standardization. Analysis Averaging WL Calibration Ы Drift Correction Type Standardization **Display Preferences** Test Info Settings Select your RM or CRM 40% 9:49 PM Type Standardization < Select the Alloy Type, aka Base, that contains your RM or CRM. SELECT BASE StainlessStd Fe


Then select the target RM or CRM from the subsequent list.

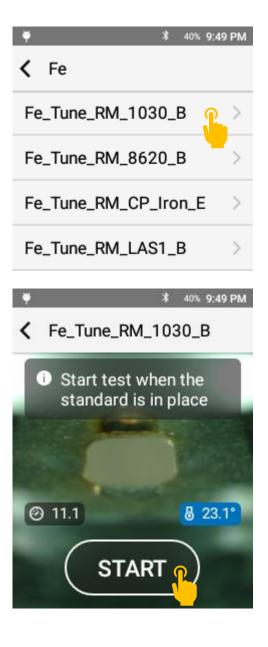

Test the Sample

Prepare the sample and then shoot the sample using the start button or the trigger. Pre-Burn settings will be applied. The system will automatically run 3 repeats on the sample. When the acquisition is complete, review the data and press save.


You are now ready to test. When a Type Standard is applied, the selected standard will be listed in the header, and there will be a target icon in the top right corner.

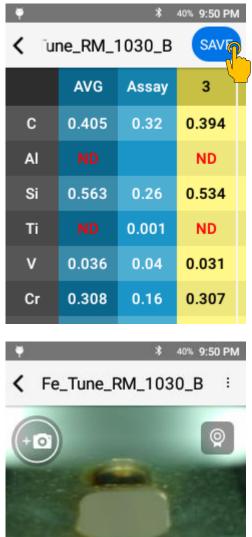



Exiting Type Standardization

Tapping the target icon or pressing the back button will exit that type standardization. Accept the prompt to exit or press cancel to maintain the Type Standardization.

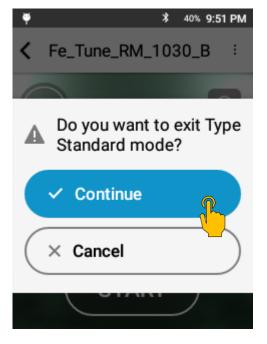

9. Sample Preparation

While the Z-900 Series has effective cleaning protocols built into the system, LIBS is still fundamentally a surface test. For a heavily corroded, dirty, or plated surface, sample preparation may be required. Sample preparation is critical for carbon analysis.

If sample preparation is required, grind an area approximately 0.75 in/20 mm in diameter. The minimum sample prep area is 0.15 in / 4 mm. Then use the camera to align the test location in the center of the prepared area.

SciAps recommends the Milwaukee M12 Right Angle Die Grinder or the Milwaukee M12 Variable Speed Polisher/Sander and the Norton Saint Gobain Blaze R980P Quick Change disc (2" or 3" diameter, 50 grit).

Proper grinding technique will result in a shiny surface with linear grind marks (not swirls).



10. Alloy(+) Mode

Alloy(+) Mode Overview

This testing app is used for quantitative analysis of alloys. The mode utilizes argon OptiPurge technology to purge the testing chamber with argon – an inert gas. The argon environment increases the plasma life, improving signal to noise ratio. Additionally, the argon atmosphere increases the overall intensity of the plasma and limits impact of atmospheric absorption.

Alloy and Alloy+ share the same user interface and functions. Alloy uses a single spectrometer covering 200 - 420 nm. Alloy+ uses two spectrometers to achieve an expanded wavelength range of 190 - 610 nm.

Element Suite

Alloy Mode:

Alloy Family	Elements Included
Aluminum	Be, Mg, Al, Si, Ti, V, Cr, Mn, Fe, Ni, Cu, Zn, Zr, Pb, Bi, Ag
Titanium	Al, Si, Ti, V, Cr, Mn, Fe, Ni, Zr, Nb, Mo, Sn
Low Alloy Steel (Fe)	Al, Si, Ti, V, Cr, Mn, Fe, Co, Cu, Ni, Nb, Mo, W, Pb
Stainless Steel	Al, Si, Ti, V, Cr, Mn, Fe, Co, Ni, Cu, Se, Nb, Mo, W
Nickel	Al, Si, Ti, Cr, Mn, Fe, Co, Ni, Cu, Nb, Mo, W, Hf, Ta, Re
Copper	Be, Al, Si, Cr, Mn, Fe, Co, Ni, Cu, Zn, Se, Ag, Sn, Pb, Bi

Cobalt	Al, Si, Ti, Cr, Mn, Fe, Co, Ni, Cu, Nb, Mo, W
Specialty **	V, Cr, Mn, Ag, Ta, Hf, Re, Pb, Zr, Mg, Zn, Mo, W, Sn, Nb

Alloy+ Mode:

Alloy Family	Elements Included
Aluminum	Li, Be, Mg, Al, Si, Ti, V, Cr, Mn, Fe, Ni, Cu, Zn, Zr, Pb, Bi, Ag
Titanium	Al, Si, Ti, V, Cr, Mn, Fe, Ni, Zr, Nb, Mo, Sn
Low Alloy Steel (Fe)	Al, Si, Ti, V, Cr, Mn, Fe, Co, Cu, Ni, Nb, Mo, W, Pb
Stainless Steel	Al, Si, Ti, V, Cr, Mn, Fe, Co, Ni, Cu, Se, Nb, Mo, W
Nickel	Al, Si, Ti, Cr, Mn, Fe, Co, Ni, Cu, Nb, Mo, W, Hf, Ta, Re
Copper	Be, Al, Si, Cr, Mn, Fe, Co, Ni, Cu, Zn, Se, Ag, Sn, Pb, Bi
Cobalt	Al, Si, Ti, Cr, Mn, Fe, Co, Ni, Cu, Nb, Mo, W
Specialty **	V, Cr, Mn, Ag, Ta, Hf, Re, Pb, Zr, Mg, Zn, Mo, W, Sn, Nb

** Identifies base only – no alloying or trace element analysis.

Additional bases or elements may be set up with factory support.

Taking a Test

Place sample over the laser aperture ensuring that you completely cover the window.


Be sure to hold the sample square to the instrument so that the laser LED Spotlight is in clear focus on the sample.

Hold the sample still for the duration of the test. The test will include 6 individual test points. The system automatically moves through the full raster pattern.

Raster pattern: 6 locations x 12 cleaning pulses x 16 data pulses

In alloy mode, we fire the laser 12 times in each location to clean debris from the surface then 16 times in each location to collect data.

Rastering across the surface ensures a representative sample is collected.

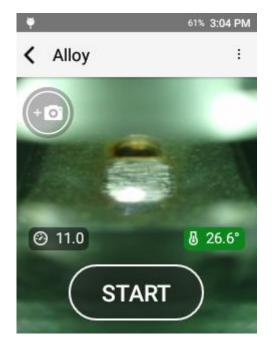

First Update

During a test, the system will deliver live updates to the chemistry as data is collected and processed.

This phase is indicated by the test status bar. While the status bar reads TESTING... the test is still in progress. The sample should be kept in the same location throughout this phase.

Test Complete

Each test is a test to completion. A complete test is indicated on screen by the test status bar turning GREEN and reading COMPLETED.

56%	6	- 2	ົ		I.W.
50%	2	2	-	LI	LV1

< #5 6061 ¹⁰⁰

.

TESTING...

Mg	0.913%	± 0.158%	0.80
Al	97.38%	± 0.355%	93.6
Si	0.503%	± 0.008%	0.40
Cr	0.091%	± 0.006%	0.04
Mn	0.088%	± 0.013%	0.00
Fe	0.577%	± 0.014%	0.00

🏺 56% 3:34 PM				
< #5	< #5 6061 ¹⁰⁰			
			0	
Mg	1.01%	± 0.091%	0.80	
Al	97.35%	± 0.351%	93.6	
Si	0.596%	± 0.064%	0.40	
Cr	0.095%	± 0.007%	0.04	
Mn	0.096%	± 0.008%	0.00	
Fe	0.481%	± 0.110%	0.00	

Alloy Result

Comprised of 6 primary components:


- 1. Test Number
- 2. Grade Match
- 3. Chemistry
- 4. Grade Compare
- 5. Camera
- 6. Test Info

Grade Match indicates the top match for the measured chemistry compared to the instrument grade library. The Grade Match Score indicates the quality of the match. A score of 100 is considered a perfect match, meaning that all measured elements match the alloy specification. The Grade Match Score is calculated by determining if each specified element is in the specified range for the grade. If it is out of range, a penalty is calculated based on how far each element is out of range. The calculated penalty for each element is summed then subtracted from 100.

. V		56% 3:	34 PM
< #5	6061 ¹⁰	0	:
			0
Mg	1.01%	± 0.091%	0.80
Al	97.35%	± 0.351%	93.6
Si	0.596%	± 0.064%	0.40
Cr	0.095%	± 0.007%	0.04
Mn	0.096%	± 0.008%	0.00
Fe	0.481%	± 0.110%	0.00

Navigating Results

Swipe left to go to an earlier result or swipe right to go to a more recent result.

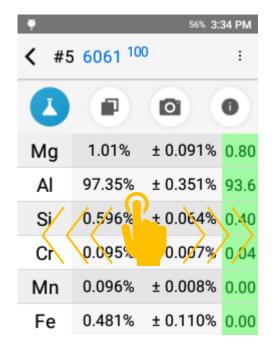

Chemistry

Chemistry lives on the first page and lists all measured elements including their concentration, the precision of the measurement (+/-), and, if there is a grade match, the grade specification for each measured element.

ND indicates non-detect. This means that the measured value failed to meet the criteria for a valid measurement. In order for an element value to be considered detected, the measured value must be greater than the 3 σ standard deviation.

See display preferences section for more information about non-detects.

Grade Specification Comparison

Tap the grade specification column to expand the grade specification (hiding the precision column).

Green indicates that the chemistry is within the specified value for the grade.

Red indicates that the chemistry is outside of the specified range.

Yellow indicates that, when considering the precision of the measurement, the reported chemistry may fall into the grade specification.

Ψ		56% 3 :	34 PM
< #5	6061 ¹⁰	0	:
			0
Mg	1.01%	± 0.091%	0.80
Al	97.35%	± 0.351%	93.6
Si	0.596%	± 0.064%	0.40
Cr	0.095%	± 0.007%	0.04
Mn	0.096%	± 0.008%	0.00
Га	0.481%	± 0.110%	0.00
Fe	0.40170	- 0.110.0	0.00
÷е Ф	0.40170	55% 3::	
Ý	6061 ¹⁰	55% 3;;	
Ý		55% 3;;	38 PM
• < #5	6061 ¹⁰	55% 3:: 0	38 PM :
• < #5	6061 ¹⁰	55% 3::	38 PM : 20%
• < #5 Mg	5 6061 ¹⁰	55% 3: 0 0 0.800%-1.	38 PM : 20% 00.00
• < #5 Mg Al	6061 ¹⁰ 1.01% 97.35%	55% 3:: 0 0.800%-1. 93.64%-10	38 PM : 20% 00.00 300%
♥ < #5 Mg Al Si	5 6061 ¹⁰ 1.01% 97.35% 0.596%	55% 3: 0 0.800%-1. 93.64%-10 0.400%-0.8	38 PM : 20% 00.00 300% 350%

Compare Grade

The Grade Compare function lives on the second page and allows the user to compare measured chemistry against any grade in the active grade library.

Tap the grade compare icon to see the top three grade matches. The grade match score is listed for each grade.


Tap Other... to see additional grade matches.

To compare with the non-top grade, tap another entry in the list.

Compare Grade

Selecting a " compare with" grade will return the system to the chemistry page.


Using the grade comparison feature, the system will visually indicate what elements are out of range for lower matches.

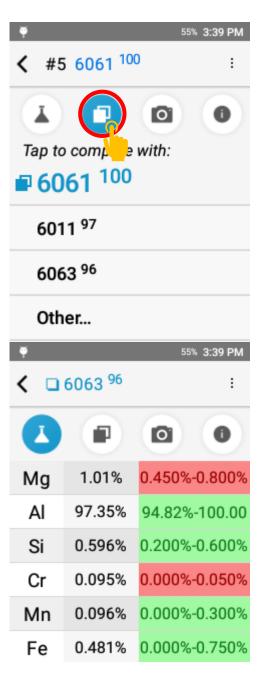

<u>Camera</u>

The Camera function lives on the third page and allows the operator to capture and attach a micro or macro image to a result for photo documentation.

Tap the camera icon to enter the camera utility. Simply tap Take a Photo to open the camera view.

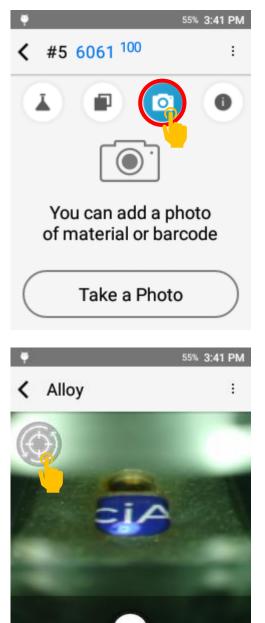

<u>Camera</u>

The camera opens in the micro view for capturing an image of the test site. Tap the switch icon in the top left corner to switch to the macro camera for capturing an image of the entire sample.


Tap the white button to capture an image.

After capturing an image, the user may save the image or retake the image.

Delete an Image

If an image is already present, the image will be displayed in the camera page.

Tap the trash can icon to delete the image.

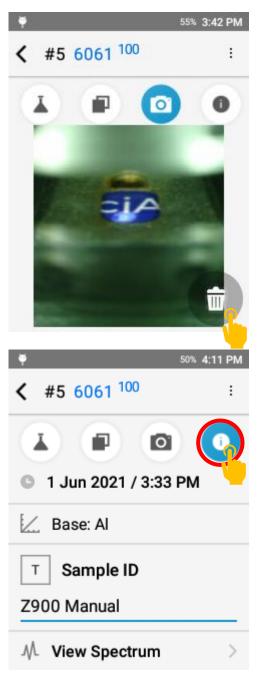

Test Info Page

The Test Info component lives on the fourth page. This page includes test metadata including date and time, calibration model used for calculation, and the ability to enter test info for record keeping.


Tap the **1** icon to access the page.

Sample ID and, if activated, Test Info fields can be populated after the test is taken.

<u>Next Test</u>

To take the next test, pull the trigger or tap the back button to return to the targeting screen.

Position your sample and pull the trigger again or tap START.

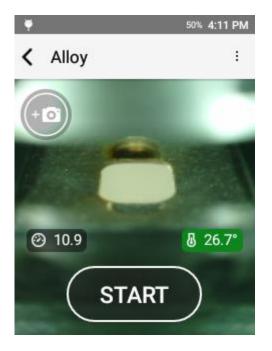


Test Setup

The Z-900 has factory default acquisition settings that are set at the factory level. Changing these settings may impact the instrument calibration and should not be done without factory authorized support. Beyond factory acquisition settings, the user or operator has the option to add in a Pre-Burn. The Pre-Burn increases the cleaning of the sample prior to taking a test and may be used for dirty or plated samples. For heavy corrosion or thick plating, grinding is recommended. When using Pre-Burn, it is important to keep the sample in the same position until the test is completed.

Activating Pre-Burn

To activate Pre-Burn, select Acquisition Settings from the options menu.

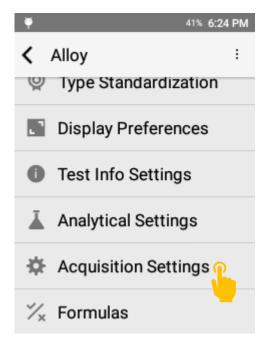

Tap Pre-Burn to open Pre-Burn options.

Pre-Burn Options

Off indicates no Pre-Burn.

Short indicates a single Pre-Burn (approximately 3 seconds).


Long indicates two back to back Pre-Burn cycles (approximately 6 seconds).

The longer the Pre-Burn, the more surface material is ablated or removed prior to collecting data.

When testing with Pre-Burn, the test status bar will indicate that the Pre-Burn is active.

Acquisition Settings Pre-burn Off Number Pre-burn pulses 25 Factory Acquisition Settings

÷

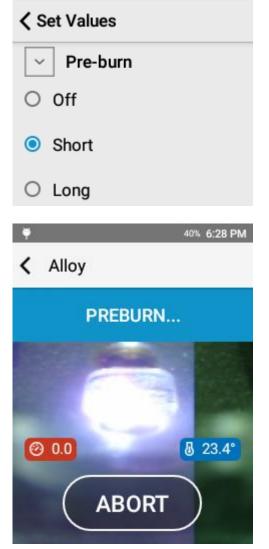

41% 6:24 PM

41% 6:25 PM

Display Preferences


The Z-900 is designed to be customized to the operator's needs. One of the primary ways we allow customization is the setup of the display preferences. This includes element display order, user selectable confidence interval, and customizable limit of detection cutoffs.

Ο

0.00

0.000

To access display preferences, open the options menu and tap display preferences.

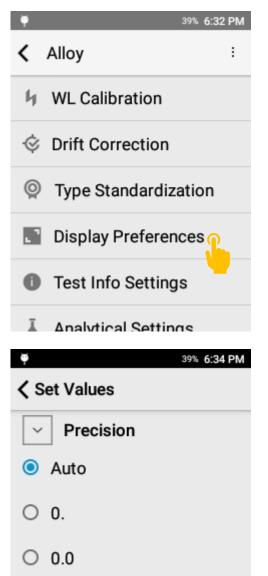

Precision

The precision setting controls the number of digits to display after the decimal point. This setting is respected in both the onscreen display and any exported report (CSV or PDF).

Chemistry

Set Elements allows the user to select what elements should be displayed (if detected) on the instrument screen.

Element Sort Order allows the operator to quickly select the order of appearance for all elements.

39% 6:34 PM

Constant Constant

CHEMISTRY

ē

Set Elements (36)

Li, Be, C, Mg, Al, Si, P, S, Ti, V, Cr, Mn, Fe, Co, Ni, Cu, Zn, Se, Y, Zr, Nb, Mo, Ru, Pd, Ag, Cd, Sn, Sb, Ba, Hf, Ta, W, Re, Au, Pb, Bi

Element Sort Order

By Atomic Number

39% 6:36 PM ę **〈** 36 / 118 ----∕↓ Select All Elements 1 2 3 4 н He Li Be 5 7 8 6 В С Ν 0 9 10 11 12 F Ne Na Mg 13 14 15 16 AI Si Ρ S

Selecting Elements

To choose what elements are displayed, tap Set Elements.

Elements highlighted with blue will be displayed if measured. Use the select all elements and deselect all elements to quickly make bulk changes.

Element Sort Order

Determines the order of appearance on the result screen.

Atomic Number will display elements based on the specific element's atomic number, or, more simply, will rank the elements by their weight. This will sort elements from the lightest element to the heaviest element.

By C oncentration sorts the elements by the measured concentration from high to low concentration.

By Symbol sorts elements alphabetically by symbol.

Custom Order allows the user to determine the preferred order of elements. Creating a Custom Element Sort Order

To create a custom order, select C ustom O rder to open the Reorder wizard.

Then tap the element you want to move and use the up and down arrows in the top right corner to move the element.

37% 6:44 PM Chem. Elements order By Atomic Number By Concentration By Symbol Custom Order Li, B, C, Mg, Al, Si, Sc, Ti, V, Cr, Mn, Fe, Co, Ni, Cu, Zn, Sr, Y, Zr, Nb, Mo, Ru, Rh, Pd, Ag, Sn, Sb, Te, Hf, Ta, W, Re, Ir, Pt, Au, Pb, Bi

φ		37%	6:43 PM
Keore	der	\checkmark	^
3 Li	Lithium		
5 B	Boron		
6 C	Carbon		
12 Mg	Magnesi	ium	
13	A		

Grade Display Settings

Number of Grades to D isplay controls the number of grades displayed in the Compare Grade page and the number of grades displayed in the PDF export.

Min Grade Match Number determines the cutoff for No Grade Match response.

Closeness to Best Match screens for alloys that are very similar in chemistry. Some alloys are so similar that they cannot be sorted on chemistry alone. If activated, this feature flags a result that has more than one grade within the set value of the top grade match.

Detected Elements

For an element to be considered detected, the measured value must be greater than the 1 sigma precision multiplied by the LOD Sigma. Thus, a higher LOD Sigma will result in less detected elements.

The system has the option to either hide or display non-detect elements. It is highly recommended to activate Show Chem < LOD as ND when Show non detect elements is active.

The LOD Sigma is defined as 3.0. The user may adjust this value if they desire.

The Display Sigma is a multiplier applied to the calculated precision. It is expected that the result will have analytical agreement with a certified value approx. 95% of the time.

37% 6:45 PM

Construction Co

GRADE

•

÷

Number of Grades To Display

Min Grade Match Number

Closeness To Best Match

37% 6:47 PM

Constant Constant

DETECTED ELEMENTS

Show non detect elements

Show Chem < LOD as ND

LOD Sigma


Display Sigma

2.0

Correction Factors

Always show correction factors, when activated, will list all calculated drift correction and type standardization factors in the calibration workflow.

This can be a powerful tool for advanced users or for troubleshooting but is typically not recommended for general usage.

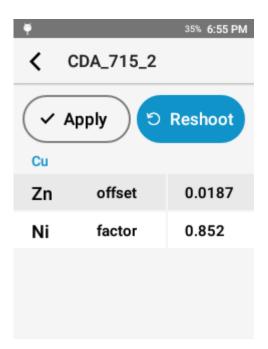


Test Info Fields

Test Info Fields are a useful tool for attaching metadata or testing notes to a result.

Test Info Setup

Test Info setup is accessed through Test Info Settings

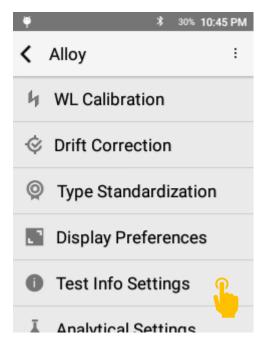


Test Info Settings

Test Info is driven by a template. To customize Test Info Fields, tap Template Setup.

Prompt for Test Info will prompt the user before each test to populate the Test Info Fields.

Clear All will reset all Test Info fields except for Sample ID.

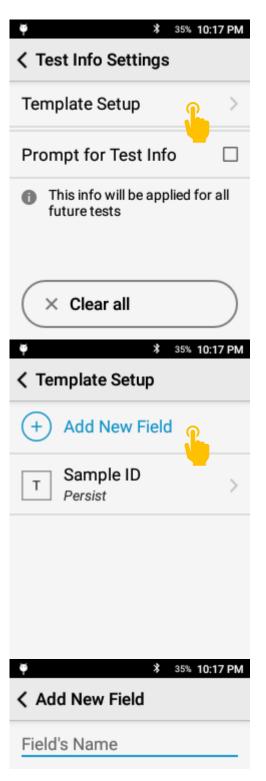

Template Setup

Modify existing fields or add new fields. Users may add a maximum of 8 fields.

To add a new field, tap Add New Field.

To modify an existing field, scroll through the list and select the target field.

Sample ID is a factory enabled field and cannot be deleted.

Enter Field Name

Each field must have a name. The name will appear in the test info page and on exported data.

Select Field Type

Free form is a general text entry.

Numeric field is numbers 0 – 9 only.

Selector gives the user a drop down menu.

Selector Field

Add multiple options for the user to select from a dropdown menu. This is a great option for consistent descriptions.

SELECT TYPE	
T Free form	~
12 Numeric field	
 ✓ Selector 	
Selector	~
 option a 	
O option b	×
+ Add Option	

Field Rules

After Selecting a Field Type, the user has the option to apply a rule.

Auto-Increment will increment the input for a field by +1 for each subsequent test.

Persist will maintain the input for a field until the user changes that field.

Auto-Increment	
Persist	

Using Test Info


After configuring the Test Info Template, Test Info Fields are ready to be used.


For training purposes, the following fields have been setup:

Prompt For Test Info

To enter values prior to a test, activate Prompt for Test Info in the Test Info Settings page.

When a test is started, the system will prompt the user to input the test info values. Enter the values then.

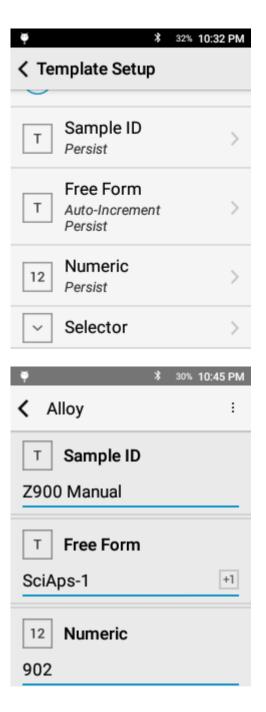

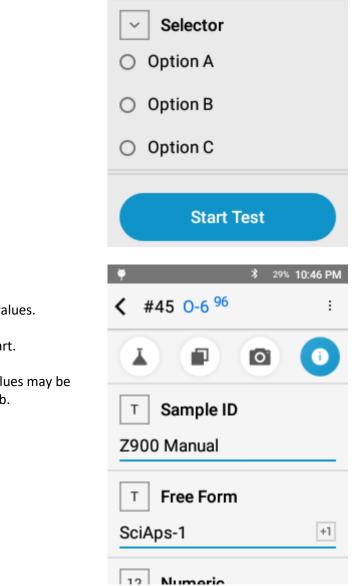

Review Values

The user may enter in all desired values.

Tap Start Test or Pull Trigger to start.

After the test is completed, the values may be reviewed and edited in the Info tab.

11. QuickSort(+) Mode

QuickSort(+) Mode Overview

This testing app is used for quantitative analysis of alloys. This air-burn mode is designed for rapid alloy analysis and alloy sorting.

QuickSort and QuickSort+ share the same user interface and functions. QuickSort uses a single spectrometer covering 200 – 420 nm. QuickSort+ uses two spectrometers to achieve an expanded wavelength range of 190 – 610 nm.

Element Suite

QuickSort Mode:

Alloy Family	Elements Included
Aluminum	Be, Mg, Al, Si, Ti, V, Cr, Mn, Fe, Ni, Cu, Zn, Zr, Pb, Bi, Ag
Titanium	Al, Si, Ti, V, Cr, Mn, Fe, Ni, Zr, Nb, Mo, Sn
Low Alloy Steel (Fe)	Al, Si, Ti, V, Cr, Mn, Fe, Co, Cu, Ni, Nb, Mo, W, Pb
Stainless Steel	Al, Si, Ti, V, Cr, Mn, Fe, Co, Ni, Cu, Se, Nb, Mo, W
Nickel	Al, Si, Ti, Cr, Mn, Fe, Co, Ni, Cu, Nb, Mo, W, Hf, Ta, Re
Copper	Be, Al, Si, Cr, Mn, Fe, Co, Ni, Cu, Zn, Se, Ag, Sn, Pb, Bi
Cobalt	Al, Si, Ti, Cr, Mn, Fe, Co, Ni, Cu, Nb, Mo, W
Specialty **	V, Cr, Mn, Ag, Ta, Hf, Re, Pb, Zr, Mg, Zn, Mo, W, Sn, Nb
QuickSort+ Mode	

QuickSort+ Mode:

Alloy Family	Elements Included
Aluminum	Li, Be, Mg, Al, Si, Ti, V, Cr, Mn, Fe, Ni, Cu, Zn, Zr, Pb, Bi, Ag
Titanium	Al, Si, Ti, V, Cr, Mn, Fe, Ni, Zr, Nb, Mo, Sn
Low Alloy Steel (Fe)	Al, Si, Ti, V, Cr, Mn, Fe, Co, Cu, Ni, Nb, Mo, W, Pb
Stainless Steel	Al, Si, Ti, V, Cr, Mn, Fe, Co, Ni, Cu, Se, Nb, Mo, W
Nickel	Al, Si, Ti, Cr, Mn, Fe, Co, Ni, Cu, Nb, Mo, W, Hf, Ta, Re
Copper	Be, Al, Si, Cr, Mn, Fe, Co, Ni, Cu, Zn, Se, Ag, Sn, Pb, Bi
Cobalt	Al, Si, Ti, Cr, Mn, Fe, Co, Ni, Cu, Nb, Mo, W
Specialty **	V, Cr, Mn, Ag, Ta, Hf, Re, Pb, Zr, Mg, Zn, Mo, W, Sn, Nb

** Identifies base only – no alloying or trace element analysis.

Additional bases or elements may be set up with factory support.

Taking a Test

Place sample over the laser aperture ensuring that you completely cover the window.

Be sure to hold the sample square to the instrument so that the laser LED Spotlight is in clear focus on the sample.

Hold the sample still for the duration of the test. The test will include 6 individual test points. The system automatically moves through the full raster pattern.


Raster pattern: 3 locations x 24 cleaning pulses x 32 data pulses

In QuickSort(+) mode, we fire the laser 24 times in each location to clean debris from the surface then 32 times in each location to collect data.

Rastering across the surface ensures a representative sample is collected. First Update

During a test, the system will deliver live updates to the chemistry as data is collected and processed.

This phase is indicated by the test status bar. While the status bar reads TESTING... the test is still in progress. The sample should be kept in the same location throughout this phase.

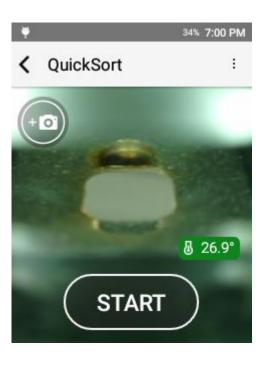

Ψ	34% 7:01 PM
< #9	9 317 ⁹⁶
	TESTING
Si	0.2183% ± 0.0616% 0.00
V	0.1379% ± 0.0047% 0.00
Cr	18.0051% ± 2.3329% <mark>18.0</mark>
Mn	1.6706% ± 0.0912% 0.00
Fe	65.2129% ± 2.8897% 57.2
Ni	10.7407% ± 0.0709% 11.0

Test Complete

Each test is a test to completion. A complete test is indicated on screen by the test status bar turning GREEN and reading COMPLETED.

QuickSort Result

Comprised of 6 primary components:

- 1. Test Number
- 2. Grade Match
- 3. Chemistry
- 4. Grade Compare
- 5. Camera
- 6. Test Info

Grade Match indicates the top match for the measured chemistry compared to the instrument grade library. The Grade Match Score indicates the quality of the match. A score of 100 is considered a perfect match, meaning that all measured elements match the alloy specification. Grade Match Score is calculated by determining if each specified element is in the specified range for the grade. If it is out of range, a penalty is calculated based on how far each element is out of range. The calculated penalty for each element is summed then subtracted from 100.

• < #9	^{34%} 7: 316 ⁹⁷	01 PM
	COMPLETED	
V	0.1178% ± 0.0169%	0.00
Cr	17.3235% ± 1.1054%	16.0
Mn	1.6493% ± 0.0833%	0.00
Fe	66.5278% ± 1.9401%	61.3
Ni	10.4406% ± 0.3875%	10.0
Cu	0.4191% ± 0.0249%	0.00
🧖 33% 7:06 PM		
〈 #1	0 316 ⁹⁶	:

< #1	0 316 96	:
		Ð
Si	0.1599% ± 0.0747%	0.00
V	0.1248% ± 0.0161%	0.00
Cr	15.9243% ± 0.8005%	16.0
Mn	1.5650% ± 0.1330%	0.00
Fe	66.0647% ± 2.0540%	61.3
Ni	11.8511% ± 0.6223%	10.0

Navigating Results


Swipe left to go to an earlier result or swipe right to go to a more recent result.

<u>Chemistry</u>

Chemistry lives on the first page and lists all measured elements including their concentration, the precision of the measurement (+/-), and, if there is a grade match, the grade specification for each measured element.

ND indicates non-detect. This means that the measured value failed to meet the criteria for a valid measurement. In order for an element value to be considered detected, the measured value must be greater than the 3 σ standard deviation.

See display preferences section for more information about non-detects.

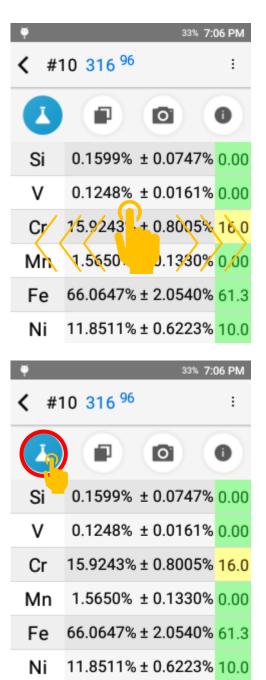

Grade Specification Comparison

Tap the grade specification column to expand the grade specification (hiding the precision column).

Green indicates that the chemistry is within the specified value for the grade.

Red indicates that the chemistry is outside of the specified range.

Yellow indicates that, when considering the precision of the measurement, the reported chemistry may fall into the grade specification.


Compare Grade

The Grade Compare function lives on the second page and allows the user to compare measured chemistry against any grade in the active grade library.

Tap the grade compare icon to see the top three grade matches. The grade match score is listed for each grade.

Tap Other... to see additional grade matches.

To compare with the non-top grade, tap another entry in the list.

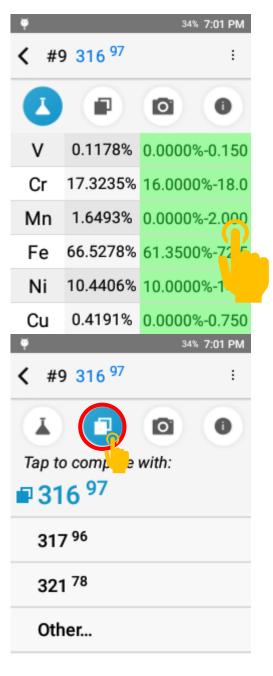

Compare Grade


Selecting a " compare with" grade will return the system to the chemistry page.

Using the grade comparison feature, the system will visually indicate what elements are out of range for lower matches.

<u>Camera</u>

The Camera function lives on the third page and allows the operator to capture and attach a micro or macro image to a result for photo documentation.

Tap the camera icon to enter the camera utility. Simply tap Take a Photo to open the camera view.

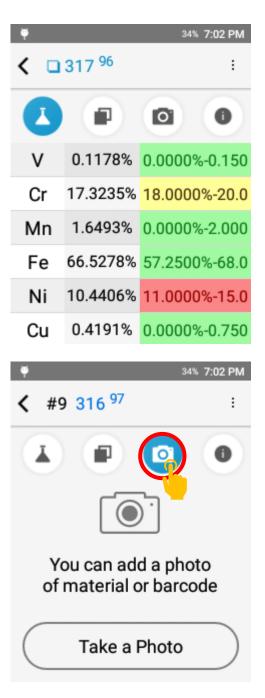


<u>Camera</u>

The camera opens in the micro view for capturing an image of the test site. Tap the switch icon in the top left corner to switch to the macro camera for capturing an image of the entire sample.

Tap the white button to capture an image.

After capturing an image, the user may save the image or retake the image.

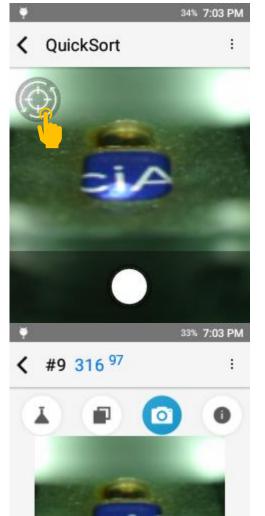

Delete an Image

If an image is already present, the image will be displayed in the camera page.


Tap the trash can icon to delete the image.

Test Info Page

The Test Info component lives on the fourth page. This page includes test metadata including date and time, calibration model used for calculation, and the ability to enter test info for record keeping.

Tap the **1** icon to access the page.

Sample ID and, if activated, Test Info fields can be populated after the test is taken.

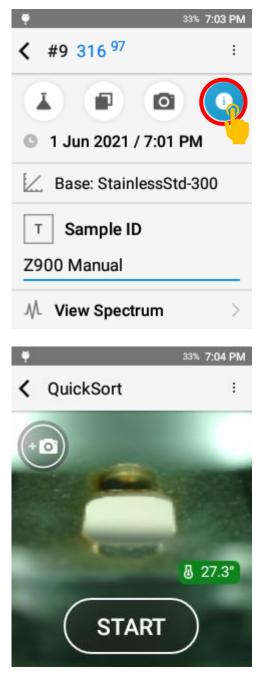

Next Test

To take the next test, pull the trigger or tap the back button to return to the targeting screen.


Position your sample and pull the trigger again or tap START.

Test Setup

The Z-900 has factory default acquisition settings that are set at the factory level. Changing these settings may impact the instrument calibration and should not be done without factory authorized support. Beyond factory acquisition settings, the user or operator has the option to add in a Pre-Burn. The Pre-Burn increases the cleaning of the sample prior to taking a test and may be used for dirty or plated samples. For heavy corrosion or thick plating, grinding is recommended. When using Pre-Burn, it is important to keep the sample in the same position until the test is completed.

Activating Pre-Burn

To activate Pre-Burn, select Acquisition Settings from the options menu.

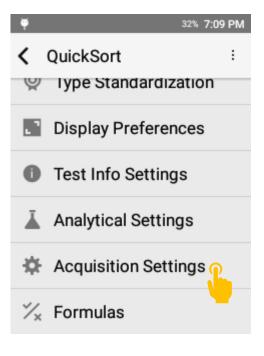

Tap Pre-Burn to open Pre-Burn options.

Pre-Burn Options

Off indicates no Pre-Burn.


Short indicates a single Pre-Burn (approximately 3 seconds).

Long indicates two back to back Pre-Burn cycles (approximately 6 seconds).

The longer the Pre-Burn, the more surface material is ablated or removed prior to collecting data.

32% 7:10 PM Ģ Acquisition Settings Pre-burn Short Number Pre-burn pulses 25 **Factory Acquisition** Settings • 41% 6:25 PM Set Values Pre-burn O Off Short O Long


When testing with Pre-Burn, the test status bar will indicate that the Pre-Burn is active.

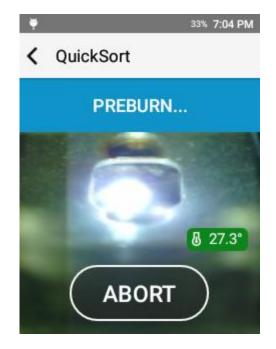

Display Preferences


The Z-900 is designed to be customized to the operator's needs. One of the primary ways we allow customization is the setup of the display preferences. This includes element display order, user selectable confidence interval, and customizable limit of detection cutoffs.

To access display preferences, open the options menu and tap display preferences.

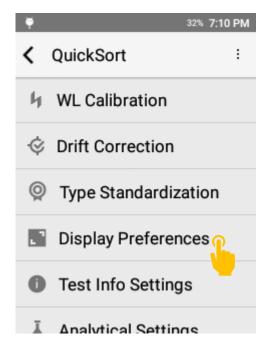

Precision

The precision setting controls the number of digits to display after the decimal point. This setting is respected in both the onscreen display and any exported report (CSV or PDF).

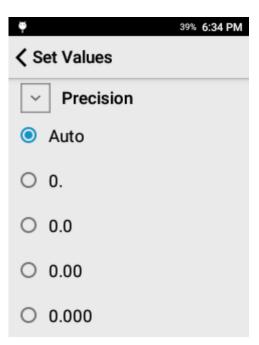

Chemistry

Set Elements allows the user to select what elements should be displayed (if detected) on the instrument screen.

Element Sort Order allows the operator to quickly select the order of appearance for all elements.

39% 6:34 PM

Constant Constant

CHEMISTRY

0

Set Elements (36)

Li, Be, C, Mg, Al, Si, P, S, Ti, V, Cr, Mn, Fe, Co, Ni, Cu, Zn, Se, Y, Zr, Nb, Mo, Ru, Pd, Ag, Cd, Sn, Sb, Ba, Hf, Ta, W, Re, Au, Pb, Bi

Element Sort Order By Atomic Number

Selecting Elements

To choose what elements are displayed, tap Set Elements

Elements highlighted with blue will be displayed if measured. Use the select all elements and deselect all elements to quickly make bulk changes.

Element Sort Order

Determines the order of appearance on the result screen.

Atomic Number will display elements based on the specific element's atomic number, or, more simply, will rank the elements by their weight. This will sort elements from the lightest element to the heaviest element.


By C oncentration sorts the elements by the measured concentration from high to low concentration.

By Symbol sorts elements alphabetically by symbol.

Custom Order allows the user to determine the preferred order of elements.

< 36 / 118 ::: ↑↓ ✓ Select All Elements

Ð

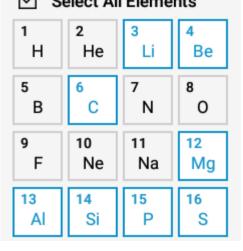

37% 6:44 PM

39% 6:36 PM

- Chem. Elements order
- By Atomic Number
- By Concentration
- By Symbol

Custom Order

Li, B, C, Mg, Al, Si, Sc, Ti, V,
 Cr, Mn, Fe, Co, Ni, Cu, Zn, Sr,
 Y, Zr, Nb, Mo, Ru, Rh, Pd,
 Ag, Sn, Sb, Te, Hf, Ta, W, Re,
 Ir, Pt, Au, Pb, Bi

Creating a Custom Element Sort Order

To create a custom order, select custom order to open the Reorder wizard.


Then tap the element you want to move and use the up and down arrows in the top right corner to move the element.

Grade Display Settings

Number of Grades to D isplay controls the number of grades displayed in the Compare Grade page and the number of grades displayed in the PDF export.

Min Grade Match Number determines the cutoff for No Grade Match response.

Closeness to Best Match screens for alloys that are very similar in chemistry. Some alloys are so similar that they cannot be sorted on chemistry alone. If activated, this feature flags a result that has more than one grade within the set value of the top grade match.

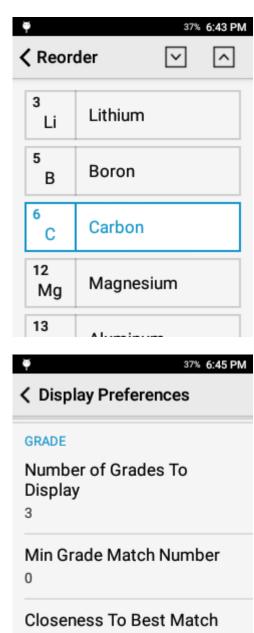

0

Detected Elements

For an element to be considered detected, the measured value must be greater than the 1 sigma precision multiplied by the LOD Sigma. Thus, a higher LOD Sigma will result in less detected elements.


The system has the option to either hide or display non-detect elements. It is highly recommended to activate Show Chem < LOD as ND when Show non detect elements is active.

The LOD Sigma is defined as 3.0. The user may adjust this value if they desire.

The Display Sigma is a multiplier applied to the calculated precision. It is expected that the result will have analytical agreement with a certified value approx. 95% of the time. **Correction Factors**

Always show correction factors, when activated, will list all calculated drift correction and type standardization factors in the calibration workflow.

This can be a powerful tool for advanced users or for troubleshooting but is typically not recommended for general usage.

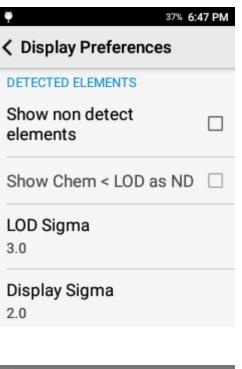



Test Info Fields

Test Info Fields are a useful tool for attaching metadata or testing notes to a result.

Test Info Setup

Test Info setup is accessed through Test Info Settings.

\$ 30% 10:41 PM QuickSort ÷ WL Calibration Orift Correction Type Standardization 0 **Display Preferences** . 1 Test Info Settings ī Analytical Settings 35% 10:17 PM • Test Info Settings **Template Setup** Prompt for Test Info This info will be applied for all 0 future tests × Clear all

Test Info Settings

Test Info is driven by a template. To customize Test Info Fields, tap Template Setup.

Prompt for Test Info will prompt the user before each test to populate the Test Info Fields.

Clear All will reset all Test Info fields except for Sample ID.

Template Setup

Modify existing fields or add new fields. Users may add a maximum of 8 fields.

To add a new field, tap Add New Field.

To modify an existing field, scroll through the list and select the target field.

Sample ID is a factory enabled field and cannot be deleted.

\$ 35% 10:17 PM \$ Template Setup Add New Field Sample ID Persist * Sample ID * \$ 35% 10:17 PM * \$ 35% 10:17 PM * \$ Add New Field

Enter Field Name

Each field must have a name. The name will appear in the test info page and on exported data.

Select Field Type

Free form is a general text entry.

Numeric field is numbers 0 – 9 only.

Selector gives the user a drop down menu.

Selector Field

Add multiple options for the user to select from a dropdown menu. This is a great option for consistent descriptions.

SELECT TYPE T Free form 12 Numeric field

Field's Name

Selector

Selector
 option a
 option b

×

+ Add Option

Field Rules

After Selecting a Field Type, the user has the option of applying a rule.

Auto-Increment will increment the input for a field by +1 for each subsequent test.

Persist will maintain the input for a field until the user changes that field. Using Test Info


After configuring the Test Info Template, Test Info Fields are ready to be used.

For training purposes, the following fields have been setup:


Prompt For Test Info

To enter values prior to a test, activate Prompt for Test Info in the Test Info Settings page.

When a test is started, the system will prompt the user to input the test info values. Enter the values then.

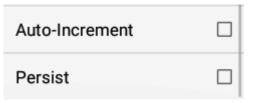

< Te	mplate Setup	
\sim		
Т	Sample ID Persist	>
Т	Free Form Auto-Increment Persist	>
12	Numeric Persist	>
~	Selector	>
œ.	*	29% 10:47 PM
	7	2.5% 10.47 FW
< Q	uickSort	:
< Q		
Т	uickSort	
Т	uickSort Sample ID	
Т Z900	uickSort Sample ID Manual Free Form	

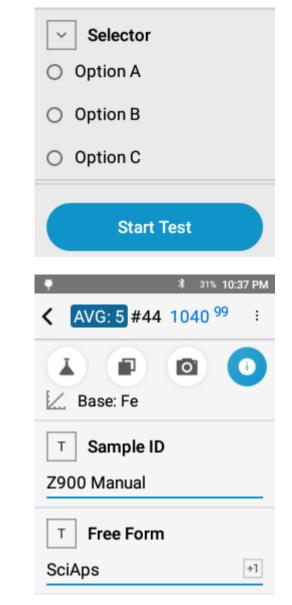

Review Values

The user may enter in all desired values.

Tap Start Test or Pull Trigger to start.

After the test is completed, the values may be reviewed and edited in the Info tab.

12. Carbon(+) Mode

Carbon(+) Mode Overview

The Carbon and Carbon+ apps are used for quantitative analysis of carbon as well as a broad range of other alloying and trace elements for Positive Material Identification, the determination of Carbon Equivalent value, and grading stainless steel. The mode utilizes argon OptiPurge technology to purge the testing chamber with argon – an inert gas. The argon environment increases the plasma life improving signal to noise ratio. An argon atmosphere is critical for carbon analysis to limit the impact of atmospheric absorption. Additionally, this mode adds in Analysis Averaging to improve accuracy and precision by averaging multiple tests with the added functionality of data rejection.

Carbon and Carbon+ share the same user interface and functions. Carbon uses 2 spectrometers covering 190 – 420 nm with a dedicated spectrometer for carbon analysis, delivering improved spectral resolution for superior carbon performance. Carbon+ uses three spectrometers to achieve an expanded wavelength range of 190 – 610 nm while maintaining a high resolution, dedicated carbon spectrometer.

Element Suite

Carbon Mode:

Alloy Family	Elements Included
Low Alloy Steel (Fe)	C, Al, Si, Ti, V, Cr, Mn, Fe, Co, Cu, Ni, Nb, Mo, W, Pb
Stainless Steel	C, Al, Si, Ti, V, Cr, Mn, Fe, Co, Ni, Cu, Se, Nb, Mo, W
Additional Option Base	s (included in Premium Model)
Aluminum	Be, Mg, Al, Si, Ti, V, Cr, Mn, Fe, Ni, Cu, Zn, Zr, Pb, Bi, Ag
Titanium	Al, Si, Ti, V, Cr, Mn, Fe, Ni, Zr, Nb, Mo, Sn
Nickel	Al, Si, Ti, Cr, Mn, Fe, Co, Ni, Cu, Nb, Mo, W, Hf, Ta, Re
Copper	Be, Al, Si, Cr, Mn, Fe, Co, Ni, Cu, Zn, Se, Ag, Sn, Pb, Bi
Cobalt	Al, Si, Ti, Cr, Mn, Fe, Co, Ni, Cu, Nb, Mo, W
Specialty **	V, Cr, Mn, Ag, Ta, Hf, Re, Pb, Zr, Mg, Zn, Mo, W, Sn, Nb

Carbon+ Mode:

Alloy Family	Elements Included
Low Alloy Steel (Fe)	C, Al, Si, Ti, V, Cr, Mn, Fe, Co, Cu, Ni, Nb, Mo, W, Pb
Stainless Steel	C, Al, Si, Ti, V, Cr, Mn, Fe, Co, Ni, Cu, Se, Nb, Mo, W
Additional Option Bases (included in Premium Model)	
Aluminum	Li, Be, Mg, Al, Si, Ti, V, Cr, Mn, Fe, Ni, Cu, Zn, Zr, Pb, Bi, Ag
Titanium	Al, Si, Ti, V, Cr, Mn, Fe, Ni, Zr, Nb, Mo, Sn
Nickel	Al, Si, Ti, Cr, Mn, Fe, Co, Ni, Cu, Nb, Mo, W, Hf, Ta, Re
Copper	Be, Al, Si, Cr, Mn, Fe, Co, Ni, Cu, Zn, Se, Ag, Sn, Pb, Bi
Cobalt	Al, Si, Ti, Cr, Mn, Fe, Co, Ni, Cu, Nb, Mo, W
Specialty **	V, Cr, Mn, Ag, Ta, Hf, Re, Pb, Zr, Mg, Zn, Mo, W, Sn, Nb

** Identifies base only – no alloying or trace element analysis.

Additional bases or elements may be set up with factory support.

Taking a Test

Carbon Mode User Interface:

Carbon(+) mode combines Pre-Burn, Multi-Shot averaging, and Data Rejection to provide quantitative analysis of C and other alloying elements.

A carbon test is considered the average of multiple individual results. Each individual test is not considered a result and should not be used for reporting or grading material.

Sample Preparation

Sample preparation is required for accurate carbon analysis.

Grind a minimum area of approximately 0.75 in (20 mm) in diameter. The minimum sample prep area is 0.15 in / 4 mm. Then use the camera to align the test location in the center of the prepared area.

SciAps recommends the Milwaukee M12 Right Angle Die Grinder or the Milwaukee M12 Variable Speed Polisher/Sander and the Norton Saint Gobain Blaze R980P Quick Change disc (2" or 3" diameter, 50 grit). Grinding discs should be changed regularly to avoid cross-contamination.

Proper grinding technique will result in a shiny surface with linear grind marks (not swirls).

Place sample over the laser aperture ensuring that you completely cover the window.


Be sure to hold the sample square to the instrument so that the laser LED Spotlight is in clear focus on the ground portion of the sample.

Hold the sample still for the duration of the test. The test will include pre-burn and multi-shot average across 6 unique raster points. The system automatically moves through the full raster pattern.

Typical Raster pattern: 1-2 Pre-Burns, 3-5 shot average, each individual test: 6 locations x 12 cleaning pulses x 16 data pulses

Rastering across the surface ensures a representative sample is collected.



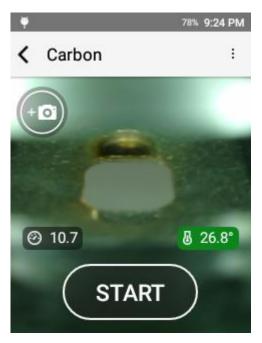

Pre-Burn

Pre-Burn is critical for removing any additional contamination from the surface that is left after grinding. The factory recommendation is to use a Short Pre-Burn with 25 Pre-Burn pulses per location.

70% 10:08 PM

Acquisition Settings

Pre-burn Short

SHOL

ę

Number Pre-burn pulses 25

Factory Acquisition Settings

Matrix View

After the Pre-Burn, the system will populate a matrix with each individual test. All measured elements will be reported in the matrix.

The Matrix view includes:

- Formulas (e.g. IIW) and elements (grey column)
- the average of all selected tests (blue column)
- Each individual test

Pan up and down by swiping on the screen.

Ý		6	9% 10:15 PM
< Ca	arbon		SAVE
	AVG	5	4
ııw	0.578	0.550	0.577
с	0.367	0.344	0.365
AI	ND	ND	ND
Si	0.423	0.398	0.441
Ti	ND	ND	ND
v	0.027	ND	0.028

Data Rejection

To account for outliers in the data (typically a product of movement during the test or carbon inclusions in the material), the user may tap a column to reject that test from the average.

A rejected test will be greyed out and the number will be replaced by an X.

Save Test

After qualifying the data and rejecting outliers, press save to generate a Carbon Result.

Ψ		6	^{8%} 10:20 PM	
< Ca	arbon		SAVE	
	AVG	х	4	
ııw	0.585	0.550	0.577	
с	0.373	0.344	0.365	
AI	ND	ND	ND	
Si	0.429	of	0.441	
Ті	ND	ND	ND	
v	0.028	ND	0.028	
~				
Ψ		6	8% 10:20 PM	
	arbon	6	540 SAVE	
	arbon AVG	6 X		
			SAVE	
< Ca	AVG	x	SAVE	
Ca	AVG 0.585	X 0.550	SAVE 4 0.577	
Ca IIW C	AVG 0.585 0.373	X 0.550 0.344	SAVE 4 0.577 0.365	
 Call IIIW Call AI 	AVG 0.585 0.373 ND	X 0.550 0.344 ND	4 0.577 0.365 ND	

Carbon Result

Comprised of 7 primary components:

- 1. Average Indicator
- 2. Test Number
- 3. Grade Match
- 4. Chemistry
- 5. Grade Compare
- 6. Camera
- 7. Test Info

Grade Match indicates the top match for the measured chemistry compared to the instrument grade library. The Grade Match Score indicates the quality of the match. A score of 100 is considered a perfect match, meaning that all measured elements match the alloy. The Grade Match Score is calculated by determining if each specified element is in the specified range for the grade. If it is out of range, a penalty is calculated based on how far each element is out of range. The calculated penalty for each element is summed then subtracted from 100.

Navigating Results

Swipe left to go to an earlier result or swipe right to go to a more recent result.

		67% 10:	23 PM
< A\	/G: 4 #26	1040 ¹⁰⁰	:
			0
IIW	0.585%	± 0.066%	
С	0.373%	± 0.025%	0.37
Al	ND	< 0.010%	0.00
Si	0.429%	± 0.013%	0.00
Ti	ND	< 0.001%	0.00
V	0.028%	± 0.002%	0.00
Cr	0.177%	± 0.015%	0.00
Mn	0.777%	± 0.054%	0.60
Fe	97.78%	± 0.181%	0.00
Ni	ND	< 0.012%	0.00
Cu	0.273%	± 0.007%	0.00
Nb	ND	< 0.042% 67% 10:	
< A\	/G: 4 #26	1040 ¹⁰⁰	:
			0
IIW	0.585%	± 0.066%	
С	0.373%	± 0.025%	0.37
AI	/ ND	< 0.010%	0.00
Si	0.429%	0.073%	0,00
Ti	ND	< 0.001%	0.00
۷	0.028%	± 0.002%	0.00

Formulas

Any active formulas will be displayed at the top of the result and color coded according to configured action levels.

See formulas for more information. Available factory formulas include:

- Dearden O'Neil CE
- AWS CE
- CSA Z662
- Critical Metal Parameter (Pcm)

Chemistry

Chemistry lives on the first page and lists all measured elements including their concentration, the precision of the measurement (+/-), and, if there is a grade match, the grade specification for each measured element.

ND indicates non-detect. This means that the measured value failed to meet the criteria for a valid measurement. In order for an element value to be considered detected, the measured value must be greater than the 3 σ standard deviation.

See display preferences section for more information about non-detects.

Ŷ		65% 10 :	33 PM
< A\	/G: 5 #37	1005 ¹⁰⁰	:
		0	0
IIW	0.026%	± 0.034%	
С	0.009%	± 0.005%	0.00
Al	ND	< 0.008%	0.00
Si	0.084%	± 0.021%	0.00
Ti	ND	< 0.000%	0.00
V	ND	< 0.002%	0.00
Ţ		67% 10 :	23 PM
< A\	/G: 4 #26	1040 ¹⁰⁰	:
< A	/G: 4 #26	1040 100	•
		0	
		0 ± 0.066%	0
	0.585%	0 ± 0.066%	0.37
C	0.585% 0.373% ND	• 0.066% ± 0.025%	 0.37 0.00
C Al	0.585% 0.373% ND	<pre> 0.066% 1.0025% 0.010% </pre>	 0.37 0.00 0.00

Grade Specification Comparison

Tap the grade specification column to expand the grade specification (hiding the precision column).

Green indicates that the chemistry is within the specified value for the grade.

Red indicates that the chemistry is outside of the specified range.

Yellow indicates that, when considering the precision of the measurement, the reported chemistry may fall into the grade specification.

Compare Grade

The Grade Compare function lives on the second page and allows the user to compare measured chemistry against any grade in the active grade library.

Tap the grade compare icon to see the top three grade matches. The grade match score is listed for each grade.

Tap Other... to see additional grade matches.

To compare with the non-top grade, tap another entry in the list.

Ψ		65% 10:36 PM
< A\	/G: 5 #37	1005 ¹⁰⁰ :
		0
IIW	0.026%	
С	0.009%	0.000%-0.060%
Al	ND	0.000%-0.00 <mark>0%</mark>
Si	0.084%	0.000%-0.300
Ti	ND	0.000%-0.0 <mark>0</mark>
V	ND	0.000%-0.030%
• < A	/G: 5 <mark></mark> #37	^{65%} 10:37 PM
Tap to	/G: 5 #37	1005 ¹⁰⁰ :
Tap to		1005 ¹⁰⁰ :
Tap to Tap to 10 Pur	comp_= 05 ¹⁰⁰	1005 ¹⁰⁰ :

Compare Grade


Selecting a " compare with" grade will return the system to the chemistry page.

Using the grade comparison feature, the system will visually indicate what elements are out of range for lower matches.

<u>Camera</u>

The Camera function lives on the third page and allows the operator to capture and attach a micro or macro image to a result for photo documentation.

Tap the camera icon to enter the camera utility. Simply tap Take a Photo to open the camera view.

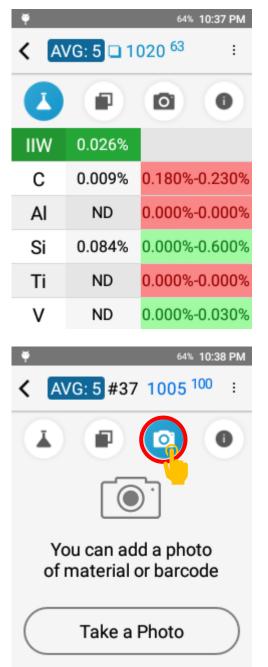


<u>Camera</u>

The camera opens in the micro view for capturing an image of the test site. Tap the switch icon in the top left corner to switch to the macro camera for capturing an image of the entire sample.


Tap the white button to capture an image.

After capturing an image, the user may save the image or retake the image.

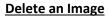

If an image is already present, the image will be displayed in the camera page.

Tap the trash can icon to delete the image.

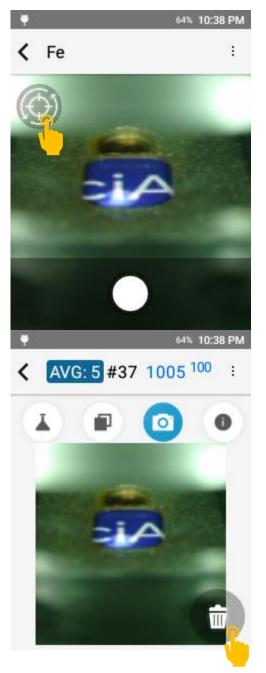


Test Info Page

The Test Info component lives on the fourth page. This page includes test metadata, including date and time, calibration model used for calculation, and the ability to enter test info for record keeping.

Tap the **1** icon to access the page.

Sample ID and, if activated, Test Info fields can be populated after the test is taken.

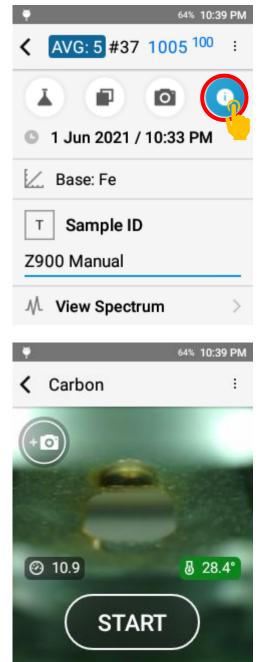

Next Test

To take the next test, pull the trigger or tap the back button to return to the targeting screen.

Position your sample and pull the trigger again or tap START.

Test Setup

The Z-900 has factory default acquisition settings that are set at the factory level. Changing these settings may impact the instrument calibration and should not be done without factory authorized support. Beyond factory acquisition settings, the user or operator has the option to add in a Pre-Burn. The Pre-Burn increases the cleaning of the sample prior to taking a test and may be used for dirty or plated samples. For heavy corrosion or thick plating, grinding is recommended. When using Pre-Burn, it is important to keep the sample in the same position until the test is completed.

Managing Pre-Burn

To activate Pre-Burn, select Acquisition Settings from the options menu.

A minimum of a short Pre-Burn is recommended.

41% 6:24 PM Alloy < Type Standardization U **Display Preferences** . 1 Test Info Settings 0 Analytical Settings 🗱 Acquisition Settings 😱 🔨 Formulas 41% 6:24 PM • Acquisition Settings Pre-burn Off Number Pre-burn pulses 25 Factory Acquisition Settings

÷

Tap Pre-Burn to open Pre-Burn options.

Pre-Burn Options

Off indicates no Pre-Burn.


Short indicates a single Pre-Burn (approximately 3 seconds).

Long indicates two back to back Pre-Burn cycles (approximately 6 seconds).

The longer the Pre-Burn, the more surface material is ablated or removed prior to collecting data.

φ	41% 6:25 PM
🗸 Set Values	
✓ Pre-burn	
O Off	
Short	
○ Long	

When testing with Pre-Burn, the test status bar will indicate that the Pre-Burn is active.

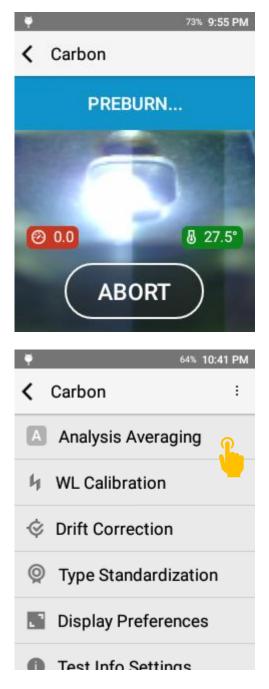

Analysis Averaging


Analysis Averaging is controlled from a dedicated menu in the Options menu.

Analysis Averaging Options:

Max Number of Tests: Sets an upper bound for the number of tests that can be included in a Carbon Result.

Auto Repeat Test: When active, only one trigger pull is required to run Pre-Burn and the Auto Shot Number of tests. Essentially, 1 trigger pull to collect all of the required tests.


Auto Shot Number: Target number of tests for Carbon Result.

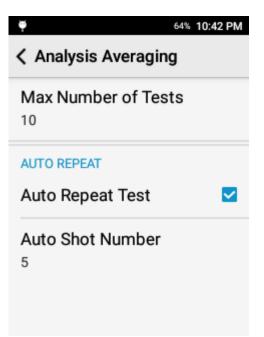

Display Preferences


The Z-900 is designed to be customized to the operator's needs. One of the primary ways the user may customize is the setup of the display preferences. This includes element display order, user selectable confidence interval, and customizable limit of detection cutoffs.

To access display preferences, open the options menu and tap display preferences.

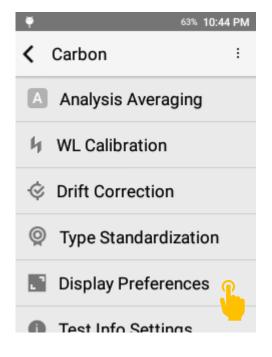

Precision

The precision setting controls the number of digits to display after the decimal point. This setting is respected in both the onscreen display and any exported report (CSV or PDF).

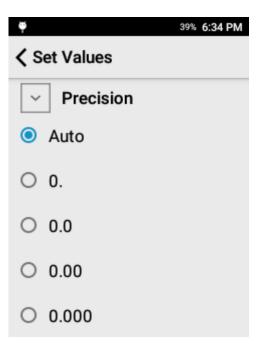

Chemistry

Set Elements allows the user to select what elements should be displayed (if detected) on the instrument screen.

Element Sort Order allows the operator to quickly select the order of appearance for all elements.

39% 6:34 PM

Display Preferences

CHEMISTRY

0

Set Elements (36)

Li, Be, C, Mg, Al, Si, P, S, Ti, V, Cr, Mn, Fe, Co, Ni, Cu, Zn, Se, Y, Zr, Nb, Mo, Ru, Pd, Ag, Cd, Sn, Sb, Ba, Hf, Ta, W, Re, Au, Pb, Bi

Element Sort Order By Atomic Number

Selecting Elements

To choose what elements are displayed, tap Set Elements.

Elements highlighted with blue will be displayed if measured. Use the select all elements and deselect all elements to quickly make bulk changes.

Element Sort Order

Determines the order of appearance on the result screen.

Atomic Number will display elements based on the number of protons in the element's nucleus or, more simply, will rank the elements by their weight. This will sort elements from the lightest element to the heaviest element.

By C oncentration sorts the elements by the measured concentration from high to low concentration.

By Symbol sorts elements alphabetically by symbol.

Custom Order allows the user to determine their preferred order of elements.

37% 6:44 PM

39% 6:36 PM

4

8

Be

0

Mg

S

12

16

↑↓

....

Chem. Elements order

Select All Elements

3

7

11

15

Li

Ν

Na

Ρ

2

6

10

14 Si

He

С

Ne

- By Atomic Number
- By Concentration
- By Symbol

Ð

1

5

9

13

н

В

F

AI

〈 36 / 118

Custom Order

Li, B, C, Mg, Al, Si, Sc, Ti, V,
 Cr, Mn, Fe, Co, Ni, Cu, Zn, Sr,
 Y, Zr, Nb, Mo, Ru, Rh, Pd,
 Ag, Sn, Sb, Te, Hf, Ta, W, Re,
 Ir, Pt, Au, Pb, Bi

Creating a Custom Element Sort Order

To create a custom order, select custom order to open the Reorder wizard.


Then tap the element you want to move and use the up and down arrows in the top right corner to move the element.

Grade Display Settings

Number of Grades to D isplay controls the number of grades displayed in the Compare Grade page and the number of grades displayed in the PDF export.

Min Grade Match Number determines the cutoff for No Grade Match response.

Closeness to Best Match screens for alloys that are very similar in chemistry. Some alloys are so similar that they cannot be sorted on chemistry alone. If activated, this feature flags a result that has more than one grade within the set value of the top grade match.

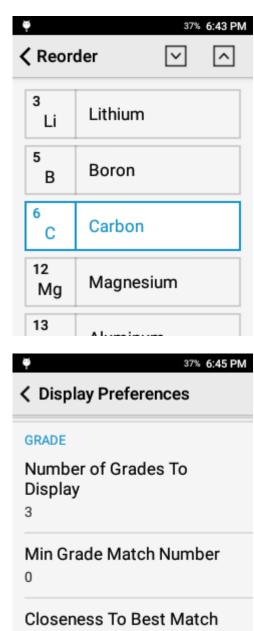

0

Detected Elements

For an element to be considered detected, the measured value must be greater than the 1 sigma precision multiplied by the LOD Sigma. Thus, a higher LOD Sigma will result in less detected elements.


The system has the option to either hide or display non-detect elements. It is highly recommended to activate Show Chem < LOD as ND when Show non detect elements is active.

The LOD Sigma is defined as 3.0. The user may adjust this value if they desire.

The Display Sigma is a multiplier applied to the calculated precision. It is expected that the result will have analytical agreement with a certified value approx. 95% of the time. **Correction Factors**

Always show correction factors, when activated, will list all calculated drift correction and type standardization factors in the calibration workflow.

This can be a powerful tool for advanced users or for troubleshooting but is typically not recommended for general usage.

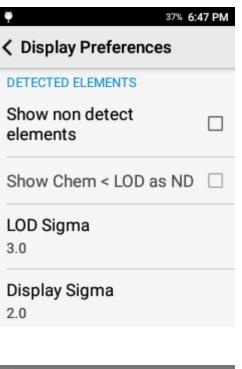




Test Info Fields

Test Info Fields are a useful tool for attaching metadata or testing notes to a result.

Test Info Setup

Test Info setup is accessed through Test Info Settings.

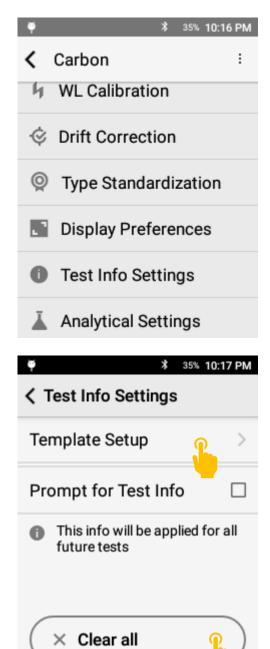

Test Info Settings

Test Info is driven by a template. To customize Test Info Fields, tap Template Setup.

Prompt for Test Info will prompt the user before each test to populate the Test Info Fields.

Clear All will reset all Test Info fields except for Sample ID.


Template Setup

Modify existing fields or add new fields. Users may add a maximum of 8 fields.

To add a new field, tap Add New Field.

To modify an existing field, scroll through the list and select the target field.

Sample ID is a factory enabled field and cannot be deleted.

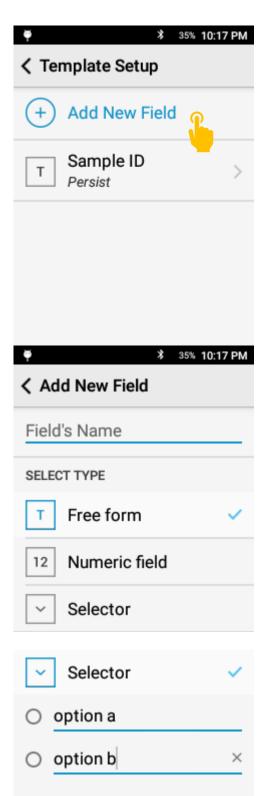

+ Add Option

Enter Field Name

Each field must have a name. The name will appear in the test info page and on exported data.

Select Field Type

Free form is a general text entry.

Numeric field is numbers 0 – 9 only

Selector gives the user a drop down menu.

Selector Field

Add multiple options for the user to select from a dropdown menu. This is a great option for consistent descriptions.

Field Rules

After Selecting a Field Type, the user has the option of applying a rule.


Auto-Increment will increment the input for a field by +1 for each subsequent test.


Persist will maintain the input for a field until the user changes that field.

Using Test Info

After configuring the Test Info Template, Test Info Fields are ready to be used.

For training purposes, the following fields have been setup:

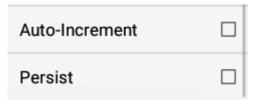


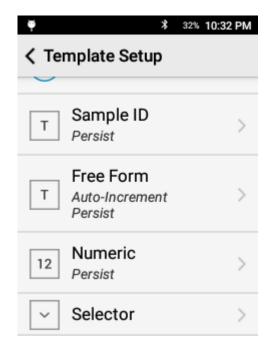

Prompt For Test Info

To enter values prior to a test, activate Prompt for Test Info in the Test Info Settings page.

When a test is started, the system will prompt the user to input the test info values. Enter the values then.

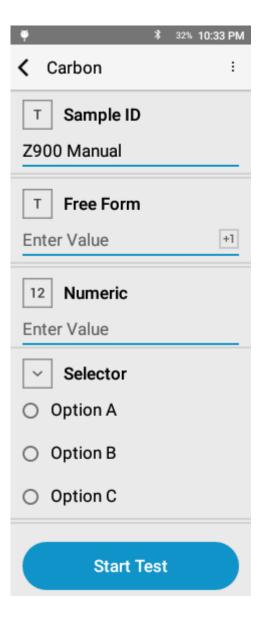


Review Values

The user may enter in all desired values.

Tap Start Test or Pull Trigger to start.

After the test is completed, the values may be reviewed and edited in the Info tab.

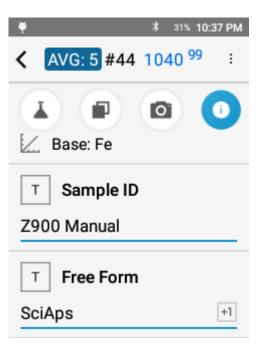

Formulas

Factory Formulas

The Carbon(+) mode comes standard with the following Factory Formulas

American Welding Society (AWS)	$AWS = \%C + \frac{\%Mn + \%Si}{6} + \frac{\%Cr + \%Mo + \%V}{5} + \frac{\%Cu + \%Ni}{15}$
Dearden and O'Neill (IIW)	$IIW = \%C + \frac{\%Mn}{6} + \frac{\%Cr + \%Mo + \%V}{5} + \frac{\%Cu + \%Ni}{15}$
Critical Metal	
Parameter (Pcm)	$P_{cm} = \%C + \frac{\%Si}{30} + \frac{\%Mn + \%Cu + \%Cr}{20} + \frac{\%Ni}{60} + \frac{\%Mo}{15} + \frac{\%V}{10} + 5 \times \%B$
*B is a nominal value	
of 0.007 per ASTM	
415	
CSA Z662 (CSA)	
	$CSA = \%C + F\left(\frac{\%Mn}{6} + \frac{\%Si}{24} + \frac{\%Cu}{15} + \frac{\%Ni}{210} + \frac{\%Cr + \%Mo + \%V + \%Nb}{5} + 5 \times \%B\right)$
*B is a nominal value	(6 24 15 210 5)
of 0.007 per ASTM	
415	

	Compliance fac		– Carbon equivalent for ause 7.6.4.4.)	ormula
	Carbon content, %	F	Carbon content, %	F
	Less than 0.06	0.53	0.14	0.85
	0.06	0.54	0.15	0.88
	0.07	0.56	0.16	0.92
	0.08	0.58	0.17	0.94
	0.09	0.62	0.18	0.96
	0.10	0.66	0.19	0.97
	0.11	0.70	0.20	0.98
	0.12	0.75	0.21	0.99
	0.13	0.80	Greater than 0.21	1.00
Seferian CE	Sef = %C + 0.	111(% <i>M</i>	(<i>n</i> + % <i>Cr</i>) + 0.055(%	0Ni) + 0.078(%Mo)
API 5L				
			NbV = % Nb + % V	•
		-	NbV = % Nb + % V $Ti = % Nb + % V +$	
Hydrofluoric Alkylation (API 751)		NbV		-%Ti
Hydrofluoric Alkylation (API 751)		NbV CNC	Ti = % Nb + % V +	%Ti %Cu
•		NbV CNC N	Ti = % Nb + % V + C = % Cr + % Ni + %	%Ti %Cu u
•	Crt	NbV CNC N	Ti = % Nb + % V + C $Ti = % Cr + % Ni + %$ $ViCu = % Ni + % C$	%Ti %Cu u

13. Pipeline Mode

Pipeline is a dedicated app for determining chemical composition and Carbon Equivalent value for Pipeline Integrity Management in accordance with API 5L Specifications. In addition to the features offered in Carbon(+) mode, the Pipeline mode offers:

Fixed Acquisition Settings

Pipeline mode standardizes the acquisition settings to:

- Pre-Burn = Long
- Number of Shots = 5
- Standard Carbon Raster Pattern

Automated Data Rejection

When the Pre-Burn and 5 intermediate tests have been taken, the system will automatically exclude the intermediate tests with the highest and lowest C value from the average.

	AVG	5	4	х	2	х
IIW	0.519	0.526	0.526	0.533	0.505	0.498
с	0.317	0.330	0.311	0.340	0.310	0.293
Al	ND	ND	ND	ND	ND	ND
Si	0.234	0.237	0.237	0.250	0.227	0.230
Ti	ND	ND	ND	ND	ND	ND
v	0.047	0.044	0.052	0.045	0.043	0.046


Type Standardization Prompt

If CE value is between 0.4 and 0.5, the system will prompt for a Type Standardization.


If the CE value is 0.4 to 0.45, the system will prompt the operator to perform a Type Standardization with RM 1020 which has an approximate CE value of 0.4.

If the CE value is 0.45 to 0.5, the system will prompt the operator to perform a Type Standardization with RM 1030 which has an approximate CE value of 0.5.


This ensures the highest quality analysis possible when a value is near the action level.

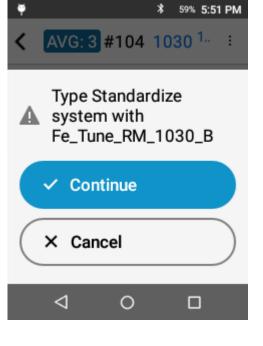

Tapping Continue will take the user directly to the Type Standardization Screen for the appropriate standard.

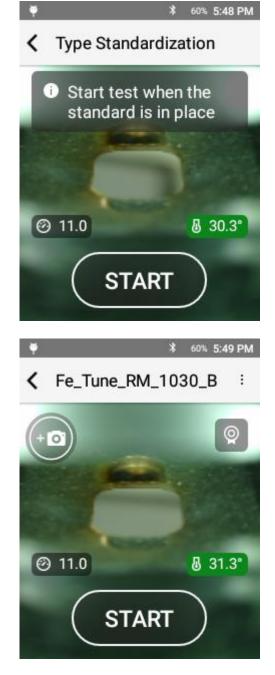

After performing the Type Standardization, the system is ready to retest the sample. When Type Standardization is active, the standard will be listed in the header. Tap the Type Standardization icon in the top right corner to exit Type Standardization.

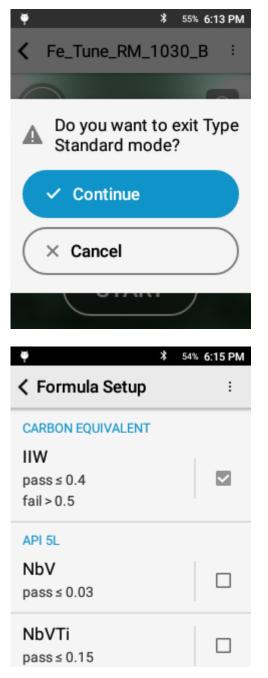

Formulas

Pipeline mode requires that one CE formula (IIW, AWS, Pcm, CSA) is selected. Additional non-CE formulas may also be included.

14. Results

All results are stored in the Results App. Use Results to review data, generate PDF reports, export data to CSV, delete data, and update Test Info.

Navigating Results

Access Results from the main home screen.



The header contains:

- Total number of tests in current view
- Multi-result selector tool
- Share Tool
- Options Menu

Results will be grouped under a header date.

Each result line will contain:

- A color coded indicator for testing mode
- AVG icon for calculated average tests
- Camera icon for results with a photo attached
- Grade Match & Grade Match Score
- Time Stamp

φ.	*	22% 11	22 PM
< 61	~	[2	:
# 47 1040 ⁹⁸		10.4	9 pm
02 Ju	ın 2021		
# 46 1040 ⁹⁹		10.4	9 pm
# 45 O-6⁹⁶		10.4	6 pm
■ # 44 <mark>AVG</mark> © 1040 ⁹⁹		10.3	5 pm
# 43 1030 ⁹⁹		10.3	5 pm


The Options may include :

- Templates Setup for customizing Excel export option
- Filter by Date to filter results by a date or date range
- A quick Export All Results key
- Function to Delete All Results


27% 10:59 PM 51 : Templates Setup Filter by Date Export All Results Delete All Results

Filter by Date

Tap Set Date Range then select either a range or a single date and tap okay.

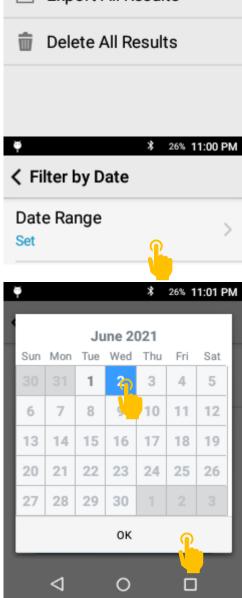

This will limit results to those taken on the days in the date range.

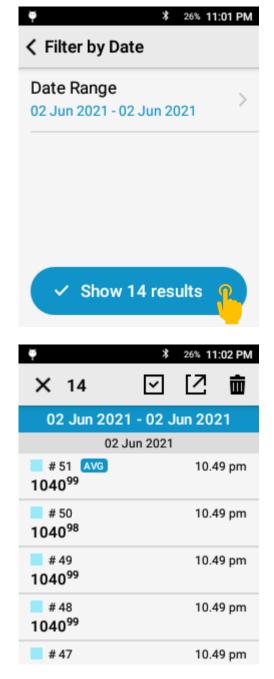

Once applied, the list will be limited to those specific results.

Exporting all results or Deleting all results from the filtered view will only include tests in the specified date range.

Data Management

To Delete all test results, open the options menu.

Then select Delete All Results.

-	*	0.70	50 514
〈 51		27% 10:	59 PM
	02 Jun 2021		
# 51 A 1040 ⁹⁹	/G	10.49	9 pm
# 50 1040 ⁹⁸		10.49	9 pm
# 49 1040 ⁹⁹		10.49	9 pm
# 48 1040 ⁹⁹		10.49	9 pm
# 47 1040 ⁹⁸		10.49	9 pm
Ψ 	*	26% 11:	03 PM
< 51			:
🖽 Tem	plates Set	up	
T Filte	r by Date		
	r by Date ort All Resu	ılts	
Expo	-		2


Tapping Delete will permanently delete the selected results.

To Delete a subset of results, use the selector button in the header row.

Ψ.	*	26% 11;	:03 PM
< 51			:
Templates	Setu	a	
A Do you rea delete 51 r			
✓ Delete		(
× Cancel)
⊲ 0)		
φ	*	27% 10	:59 PM
• < 51	*	27% 10 27	:59 PM :
51 02 Jun	J.		
•	J.	2	
02 Jun	J.	10.4	:
02 Jun # 51 (AVG) 1040 ⁹⁹ # 50	J.	[2 10.4 10.4	: 9 pm
02 Jun # 51 AVG 1040 ⁹⁹ # 50 1040 ⁹⁸ # 49	J.	[2 10.4 10.4 10.4	: 9 pm 9 pm

Select the results to delete by tapping the row then tap the delete icon.


To permanently delete those results, tap Delete.

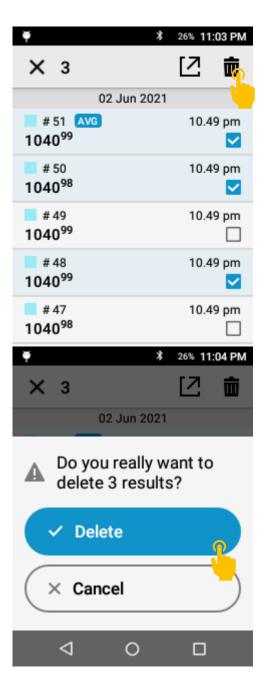

Exporting Results

Tap the share icon to export results.

You may select a subset of the results using the Filter by Date feature or the Selector function.

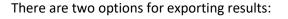

A formatted PDF report (see appendix for example)

PDF Export will respect display settings for:


- Active formulas
- Elements to display
- Precision
- Limits of Detection and Detected element display rules

An Excel (.csv) file for additional data handling or multiple tests in a single file

φ	*	27% 10:59 PM
< 51	\checkmark	[7] :
	02 Jun 2021	
# 51 AVG 1040 ⁹⁹	•	10.49 pm
# 50 1040 ⁹⁸		10.49 pm
# 49 1040 ⁹⁹		10.49 pm
# 48 1040 ⁹⁹		10.49 pm
# 47 1040 ⁹⁸		10.49 pm
Ψ	*	26% 11:05 PM
♥ < Export €		26% 11:05 PM
	51 results	26% 11:05 PM
< Export 5	51 results RMAT:	26% 11:05 PM

PDF Export

To set up PDF Export, tap PDF from the format selection screen.

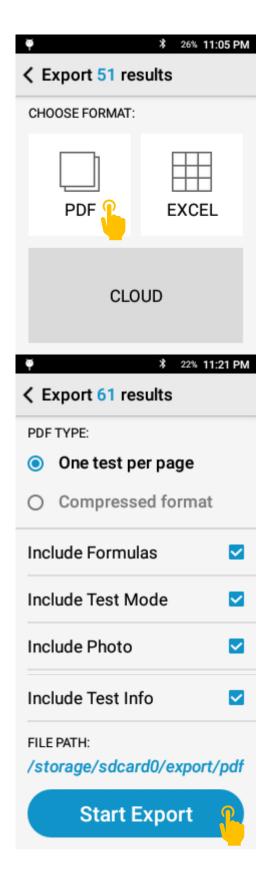

Customize Output

Select what fields to include then tap Start Export.

Export to CSV


Tap Excel.

Ψ	26% 11:05 PM		
K Export 51 results			
CHOOSE FORMAT:			
PDF			
CLOUD			
φ	¥ 19% 11:43 PM		
K Export 61 results			
✓ Overwrite file			
CHOOSE TEMPLATE:			
Default 🗸			
Z900 Manual			
Start Export			

Select export template

Custom Templates

Select Template Setup from the Options menu.

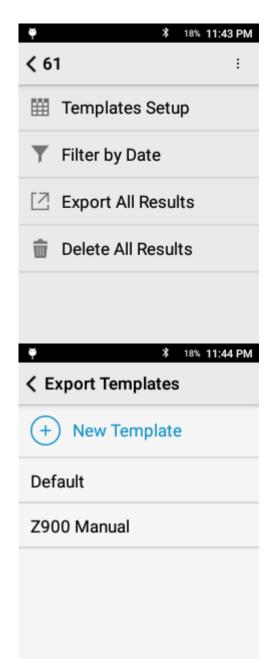

Create a new template or modify an existing template

Name template and select setup fields

Select Fields to include, Elements to include,

Additionally, may include uncertainty for each

element and test info for each result.

Formulas, and Arrange order.

· * 18% 11:44	PM
Celetaria Edit template	
Z900 Manual	_
Setup Fields	>
Delete Template)
Template Body	РМ
Fields	>
Chem Elements (32) Mg, Al, Si, Ti, V, Cr, Mn, Fe, Co, Ni, Cu, Zn, Se, Zr, Nb, Mo, Ag, Cd, Sn, Hf, Ta, W, Re, Pb, Bi, Pd, Sb, Au, P, S, Y, Ru	>
Formulas (0)	>
Arrange order	>
3	

All reports are saved to This PC\NGL\SD card\export in either the PDF or csv folder.


15. Analytical Settings

Force Base

All quantitative modes on the SciAps Z-900 Series have built- in automated base identification. However, some alloys or custom bases may cause issues for the automated base identification system. Take manual control over the system with Force Base.

Standard Operation

When Force Base is not active, the top bar will display the name of the active mode.

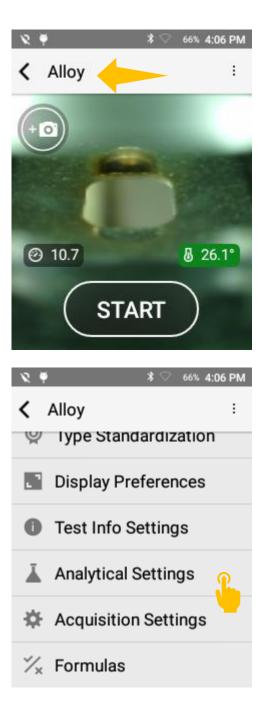


Activating Force Base

To activate Force Base, open the options menu and select Analytical Settings.

Select Force Base

Select target base (e.g. Al [Aluminum]) and then


click back to the testing screen.

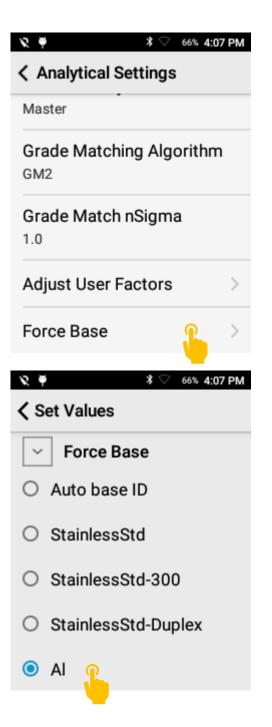

When Force Base is active, the header will display the selected base (e.g. Al) and an icon will appear in the top right corner of the camera view.

At this stage, no matter what material type is tested, the system will use the aluminum models to determine chemistry.

Tapping the icon will return the system to the Force Base menu. Select Auto base ID to return to standard, automated base identification.

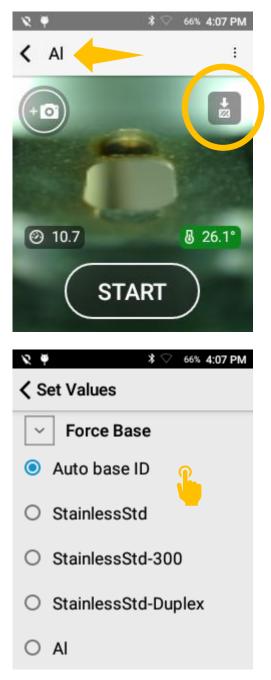


Adjust User Factors

Adjust User Factors allows the user to apply factors and offsets on a base and element specific basis to adjust chemistry. All adjustments are made to the final result. Adjust User Factors should be limited to advanced users only but can be a powerful way to adjust repeatable but biased data.


Activating Adjust User Factors

From the target testing mode, select the options menu and select analytical settings.

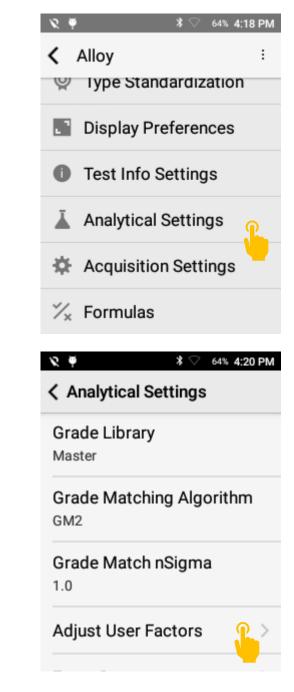


Select Adjust User Factors

Tap Customize Models

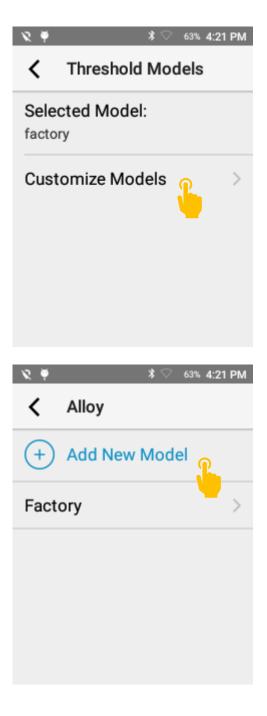

Tap Add New Model

Name Model and tap Create Model

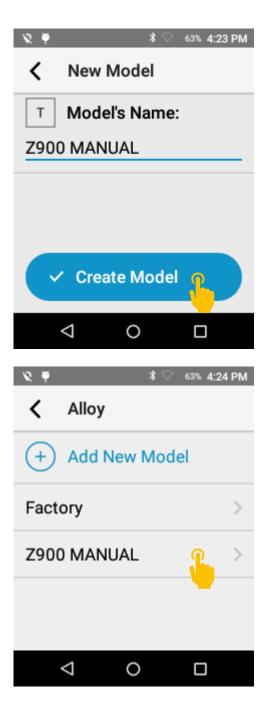


To customize, select the new model (e.g. Z900 MANUAL).

Select Base and Order to filter factors. Order is used for split curves where Order 1 is standard and Order 2 is used for low concentrations. Most elements only have Order 1. Split curves address large concentration ranges (e.g. Zn in Copper alloys).

Adjust factors, offsets, LOD sigma and % threshold. Then return to the Adjust User Factors home Screen.

× 9		*	 ○ 61% 	4:35 PM
<	Edit	Model		
Bas Al	e			>
Orde Orde				>
Edit 35	Facto	rs		>
	\triangleleft	0		
× ¥		*	 ○ 61% 	4:37 PM
<	Al / 2	2900 M	ANUAI	L
elem			_	
crem	factor	offset	sigma	% thr.
Li	factor 1.0	offset 0.0	sigma 3.0	% thr. 0.06
Li	1.0	0.0	3.0	0.06
Li Be	1.0 1.0	0.0 0.0	3.0 3.0	0.06 1.0E-4
Li Be Mg	1.0 1.0 1.0	0.0 0.0 0.0	3.0 3.0 4.0	0.06 1.0E-4 0.06


To activate your new adjusted user factors, select the new model from Selected Model drop down.

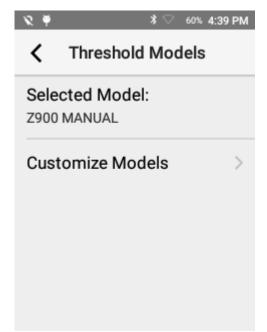


16. Formulas

Create or load formulas to elevate your instrument functionality. Set single element formulas to screen for hazardous materials, load Carbon Equivalent or other complex formulas to save time on calculations. With the added ability of action levels, take the guesswork out of analysis.

Formulas

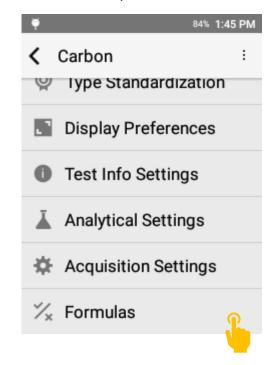

The software supports adding custom formulas or importing formulas from the Factory Library.

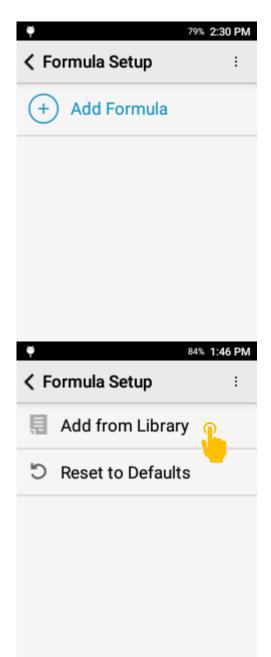

Adding Factory Formulas

Select Options and tap Add from Library.

Select all formulas to be added and return to the previous screen.

The formulas will now be available.

< Formula Library	
CARBON EQUIVALENT	
AWS	
pass≤0.4	1
fail > 0.5	_ \b
IIW	
pass≤0.4	\checkmark
fail > 0.5	
Pcm	
pass≤0.2	
P 78%	2:32 PM
< Formula Setup	:
+ Add Formula	
CARBON EQUIVALENT	
AWS	
pass≤0.4	
fail > 0.5	
IIW	
pass≤0.4	
fail > 0.5	

To activate a formula in the app, check the box to the right of the formula.

Multiple formulas may be selected at the same time.

To deactivate a formula, simply uncheck the box.

Adding a Custom Formula

Tap + Add Formula



Enter a Formula Name & Enter the formula.

Addition, Subtraction, Multiplication, and Division are supported for multi-element formulas.

Single element formulas are also supported.

minimum or maximum passing level.


Less than or equal to 1: Pass

Greater than or equal to 1: Pass

Greater than 1: Fail

Less than 1: Fail

threshold.

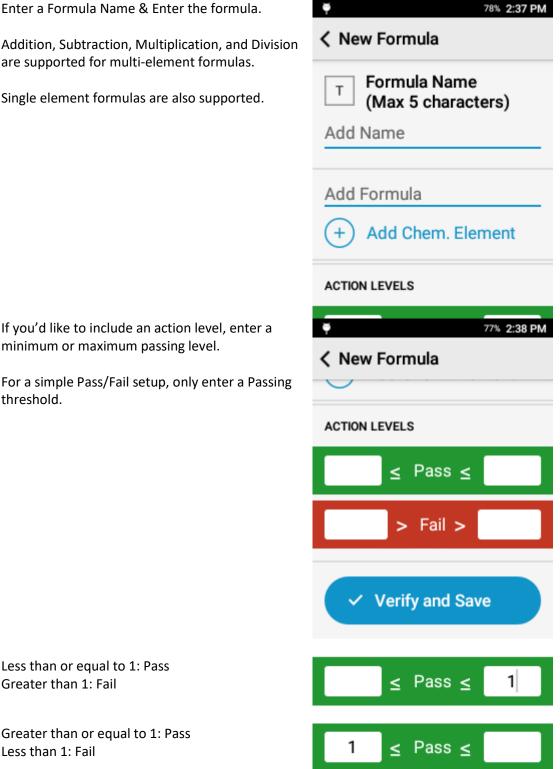

If you'd like to include an inclusive zone, include both a maximum and a minimum.

Less than or equal to 1: Pass Greater than 2: Fail Between 1 and 2: Inconclusive

Greater than or equal to 2: Pass Less than 1: Fail Between 2 and 1: Inconclusive




17. System Features


Bluetooth

Activating Bluetooth

Open Android Settings

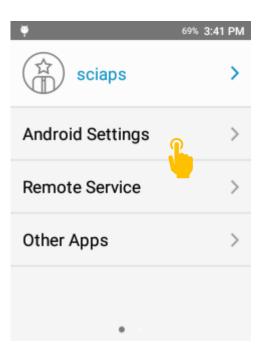


Select Bluetooth

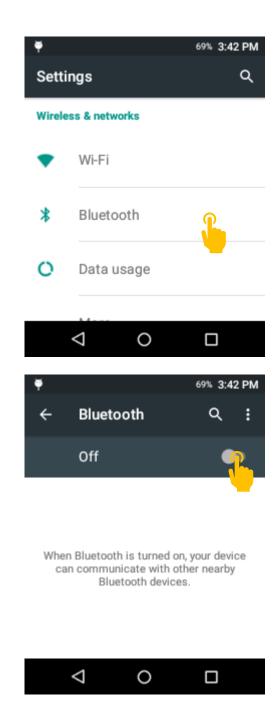

Ensure the slider is turned on


Select your device from the list of Available Devices

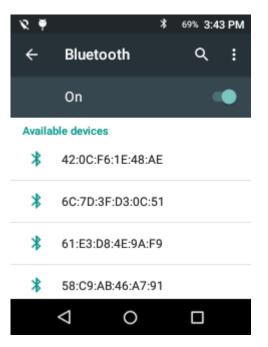


Wi-Fi

Activating Wi-Fi

Open Android Settings

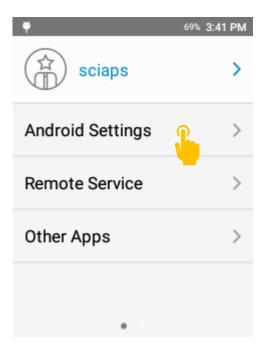

Select Wi-Fi

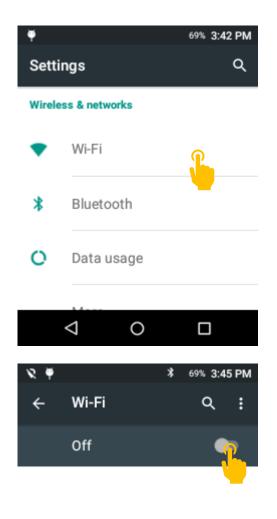


Turn on Wi-Fi by tapping the slider

To see available networks, turn Wi-Fi on.




Select your target network

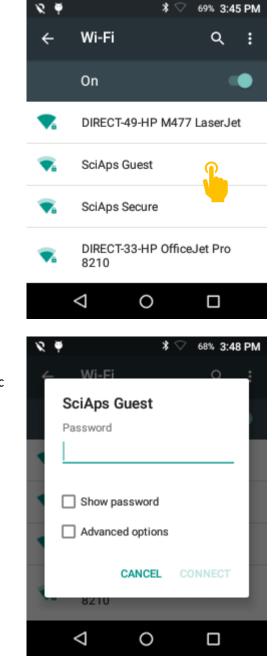


If required, enter Password then click connect.

If the system will not connect, try setting a static IP in the Advanced Options Menu.

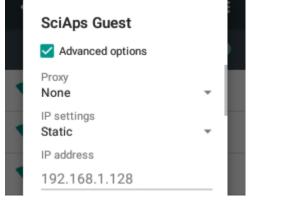

USB Connectivity

Connecting by USB is the simplest way to transfer data from your system to a computer. Connect the provided USB-C to USB-A cable to both the analyzer and the target computer. The device will appear under /This PC/ NGL/ SD Card.

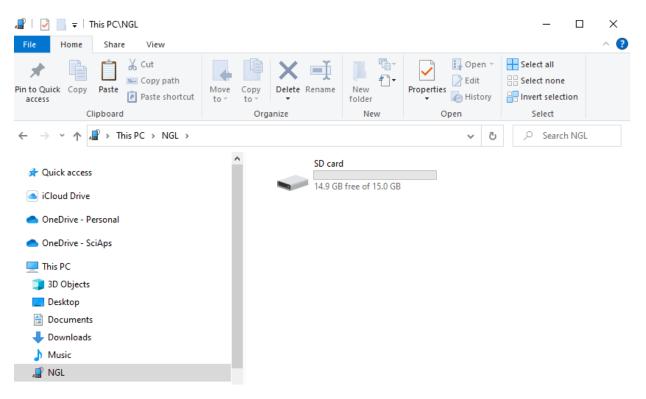


User Management


User Management allows the admin to create additional accounts, manage permissions, and reset passwords. Only an Admin can create and manage accounts unless specific permissions are given to an account.

Accessing User Management

Navigate to the settings page and tap the user icon.

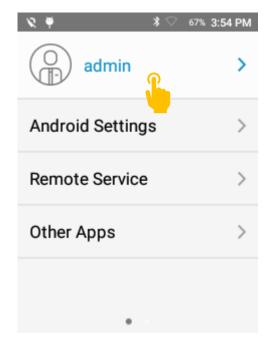


Tap Manage Users to create or manage additional user profiles.

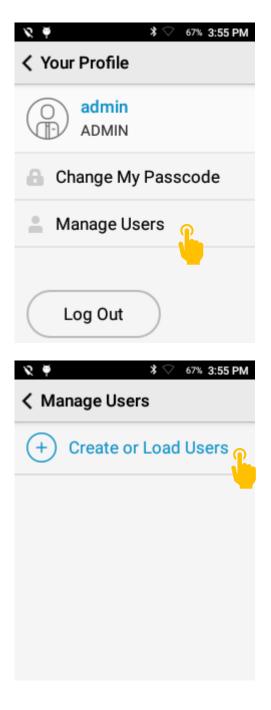


Tap Create or Load Users.

Tap Create New User.

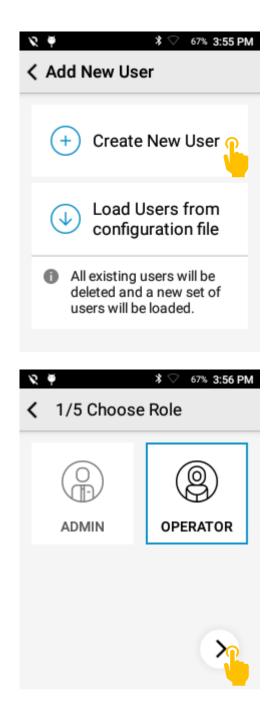


Select Operator or Admin then press > to continue.

Enter Operator Name then press > to continue.

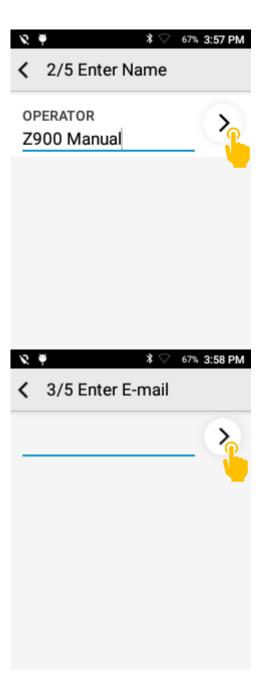

Optional: Enter Email then press > to continue.

Enter 5 digit PIN then press > to continue.

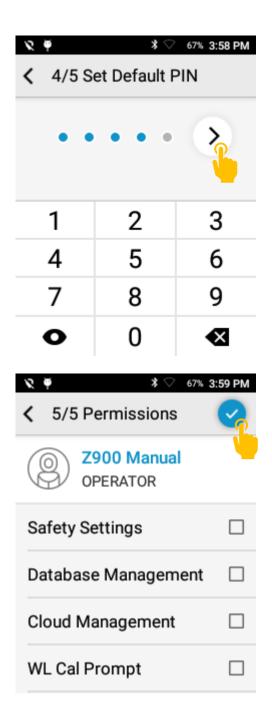

Select Permissions and click the save button.

18. Instrument Ownership

Maintenance

The Z-900 Series requires basic periodic maintenance.

Quartz Blast Shield

Primarily, the quartz blast shield requires regular cleaning. Frequency varies with the number of tests taken. On systems with argon purge, typically the window should be cleaned every 500-

1000 tests. This will vary with environment and material tested. For air-burn systems, the blast shield should be cleaned every 100-500 tests. For low melting point materials, e.g. tin or lead solder, more frequent cleaning may be required.

To clean the blast shield, shutdown the system and remove the two nose plate screws. Using a cotton swab, thoroughly wipe the quartz surface. Note – the black foam gasket should be towards the outside of the system.

The purchase of a Z-900 includes two spare blast shields in addition to the blast shield in the system. If there is significant build up of debris or pitting to this blast shield, it may need to be replaced. Frequent cleaning extends the life of the blast shield.

Note – do not use alcohol or other similar cleaning agents to clean the blast shield on units used for measuring and quantifying carbon. Using alcohol may result in contamination to the system.

Argon

The argon canister (if equipped) should be replaced when prompted.

In addition to replacing the argon canister, there is a gasket in the regulator that may wear with time and usage. If the system is not delivering the expected number of tests per canister, contact SciAps support – you may need a new argon regulator gasket.

Li-Ion Batteries

Given normal storage and usage, users can expect the battery to deliver 80% or more of its initial capacity after 300 charge/discharge cycles.

Storage & Transportation

The SciAps Z-900 Series should always be stored, transported, and shipped in the included protective case with form-fitting foam. Always shutdown the system and remove the battery before putting the instrument into the case. For extended storage, keep the system in an ambient temperature of 50° F $-95^{\circ}F 10^{\circ}C - 65^{\circ}C$ and humidity between 0 and 95%.

Check travel and shipping restrictions for details about proper handling of Li-ion batteries and argon canisters. Regulations vary by location and vendor.


Note – some airlines have restrictions on argon canisters. Check with your airline for specific policy.

Software Updates

SciAps periodically releases software updates that add features, fix software bugs, and offer other general improvements. Some updates may require the instrument to be returned to the factory, but generally, software updates can be completed remotely.

When a compatible software update is available, SciAps will reach out with an updater file in a .sup format. To run the update, copy the file to the analyzer's SD Card then follow the directions below:

Software updates are driven through the SciAps Updater app. This app can be accessed through Other Apps option.

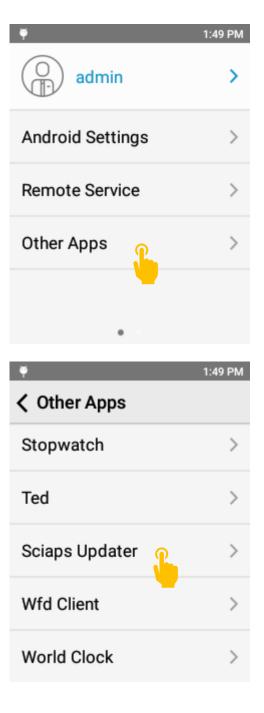


Scroll to the bottom and select SciAps Updater.


Scroll through the list to find the provided file. Select the file and tap SELECT.

The SciAps Updater app will give a brief summary of the contents of the update. Click UPDATE NOW to continue.

The system will often automatically restart after a software update.

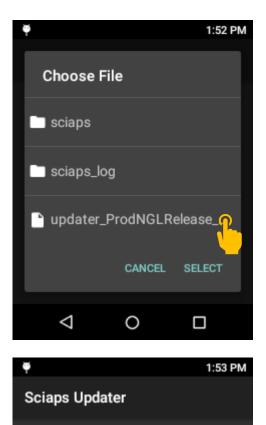

This package will install LIBS ngl-v1.1-4-0g6c26c66

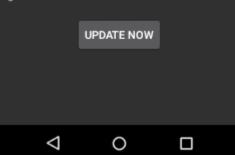

Model	Z901 QuickSor t	Z901 Alloy	Z901 CSi	Z902 QuickSort +	Z902 Alloy +	Z902 QuickSor t	Z902 Alloy	Z902 Carbon	Z902 Pipelin e	Z903 QuickSort +	Z903 Alloy +	Z903 Carbon +	Z903 Pipelin e
Argon Enabled	OFF	ON	ON	OFF	ON	OFF	ON	ON	ON	OFF	ON	ON	ON
Argon Pre- Flush Time	n/a	300	300	n/a	300	n/a	300	300	300	n/a	300	300	300
Raster Positions	3	6	6	3	6	3	6	6	6	3	6	6	6
Cleaning Pulses	24	12	12	24	12	24	12	12	12	24	12	12	12
Data Pulses	32	16	16	32	16	32	16	16	16	32	16	16	16
Data Pulse Averaging	16	16	16	16	16	16	16	16	16	16	16	16	16
Laser Pulse Rate	20 or 50 Hz	20 or 50 Hz	20 or 50 Hz	20 or 50 Hz	20 or 50 Hz	20 or 50 Hz	20 or 50 Hz	20 or 50 Hz	20 or 50 Hz	20 or 50 Hz	20 or 50 Hz	20 or 50 Hz	20 or 50 Hz
Pre-Burn	OFF	OFF	SHOR T	OFF	OFF	OFF	OFF	SHOR T	LONG	OFF	OFF	SHORT	LONG
Number Pre-burn Pulses	25	25	25	25	25	25	25	25	25	25	25	25	25
Argon Pressure Threshold	n/a	5	5	n/a	5	n/a	5	5	5	n/a	5	5	5
Low Argon Warning	n/a	ON	ON	n/a	ON	n/a	ON	ON	ON	n/a	ON	ON	ON
CCD Integration Delay	19	35	19	19	19	19	19	19	19	19	19	19	19
CCD Integration Period	0	0	0	0	0	0	0	0	0	0	0	0	0

Appendix: Default Acquisition Settings

Appendix: Grade Library Management

The Z-900 Series uses a highly user -friendly CSV file format. In the Z-900 Series, the grade library is saved as a csv file. Each library will be app specific and stored in:

SD Card/ sciaps/ App Name e.g. quicksort/ gradetables

The naming convention is:

appname LibraryName.csv

Арр	Filename	Location
Alloy	alloy_Master.csv	SD Card\sciaps\alloy\gradetables
QuickSort	quicksort_Master.csv	SD Card\sciaps\quicksort\gradetables
CSi	carbonsi_Master.csv	SD Card\sciaps\carbonsi\gradetables
Alloy+	alloyplus_Master.csv	SD Card\sciaps\alloyplus\gradetables
QuickSort+	quicksortplus_Master.csv	SD Card\sciaps\quicksortplus\gradetables
Carbon	carbon_Master.csv	SD Card\sciaps\carbon\gradetables
Carbon+	carbonplus_Master.csv	SD Card\sciaps\carbonplus\gradetables

Note 1 – file and folder names are case sensitive.

Note 2 – Only the LibraryName (e.g. Master) will appear in the system UI.

Note 3 – The system only supports csv files – not excel files.

The format of the csv file uses the following approach:

Alloy	Alloy	Standard		Eligible	Element abbrev.*	Element abbrev.**	Match
name	family*	source*	Personal notes*	for GM	*	*	Weight*
		Referenc					
name	base	е	Comments	enabled	Z_min	H_max	HMW
1100	Al	A91100	Upd 2020-01-13	TRUE			
2014	Al		Upd 2020-01-13	TRUE			
2024	Al	A92024	Upd 2020-01-13	TRUE			
CDA 197	Cu	C 19700		TRUE			
316	SS			TRUE			
317	SS			TRUE			

*optional

** A min value should be included if there is a max value

***If no max value specified, sw assumes 0

Note 1: Must include a specification for the base element. Simply set from 0 to 100 or calculate by:

Min=100-SUM(max_{all other elements})

Max=100-SUM(min all other elements)

In practice, it is a good idea to add a buffer to base elements.

Appendix: Sample PDF Report

ScirAps		Material Report	10:49 pm, 06/02/2021 7 AVG #51
CARBON 1040 98.7 2 - 10L40 95.0 3 - 1030 94.5			
CHEMICAL ELEMENTS	0.374%	± 0.016%	Free Form SciAps-7
Al Aluminum	ND	< 0.013%	Numeric 902
Silicon	0.483%	± 0.018%	Selector
Ti Titanium	ND	< 0.000%	Sample ID Z900 Manual
V Vanadium	0.038%	± 0.002%	
Cr Chromium	0.186%	± 0.013%	
Mn Manganese	0.709%	± 0.031%	
Fe	97.66%	± 0.159%	
Ni Nickel	ND	< 0.018%	
Cu Copper	0.282%	± 0.006%	
Nb Niobium	ND	< 0.043%	
Mo Molybdenum	0.225%	± 0.023%	
Pb Lead	ND	< 0.012%	

ScirAps



CARBON 1040 98.7

IIW C+Mn/6+(Cr+Mo+V)/5+(Cu+Ni)/15	0.640% fail	± 0.042%
C Carbon	0.416%	± 0.018%
V Vanadium	0.038%	± 0.002%
Cr Chromium	0.177%	± 0.008%
Mn Manganese	0.700%	± 0.030%
Fe	97.59%	± 0.137%
Ni Nickel	ND	< 0.012%
Cu Copper	0.287%	± 0.010%
Mo Molybdenum	0.217%	± 0.016%

Free Form SciAps-17 Numeric 902 Selector

Sample ID Z900 Manual

TEST INFO

