





KONICA MINOLTA

NEW

CHROMA METER CS-200

Suitable for measurement of optical
devices such as LCDs, PDPs,
organic ELs, FEDs and LEDs.

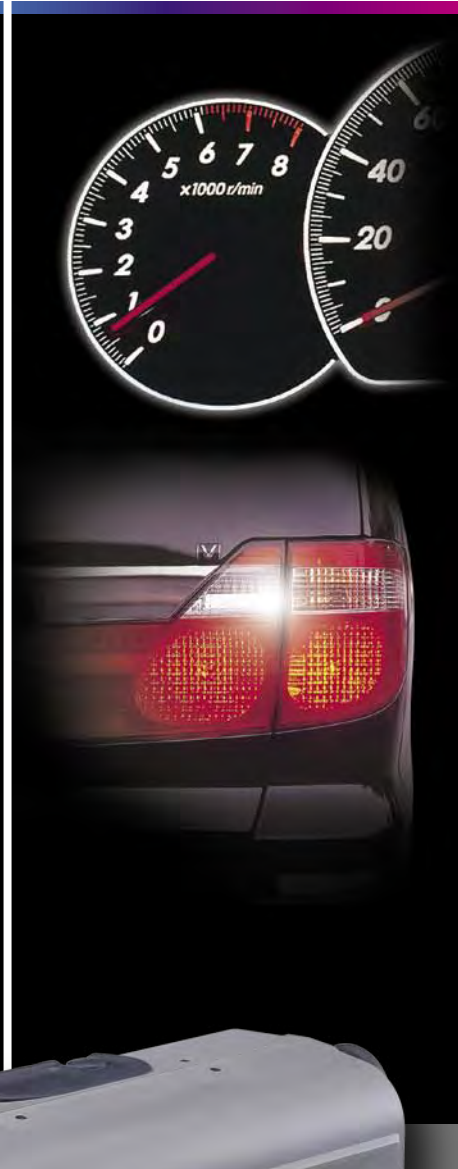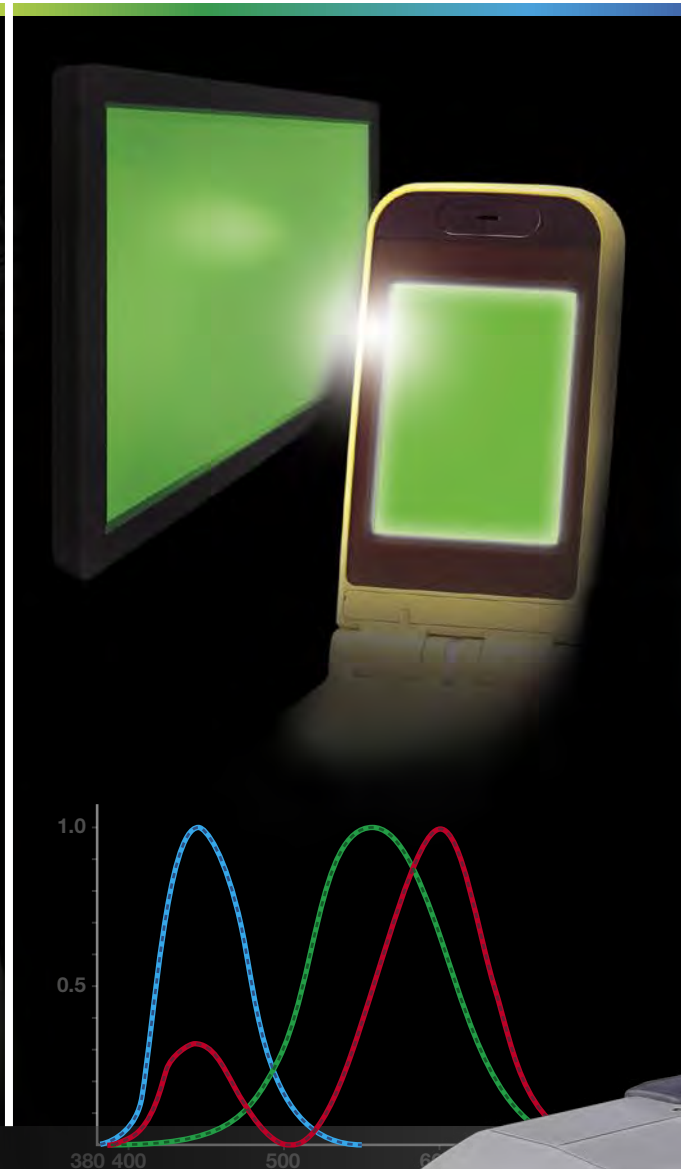

*High-Accuracy Luminance &
Chromaticity Measurement
Comparable to
Many Spectroradiometers*



The essentials of imaging

Performance Comparable to Many Spectroradiometers Ease of Use and Simplicity Equal to Tristimulus Meters

The technological innovation of displays such as FPDs and LCDs as well as LED products in recent years requires high-quality production, resulting in the need for accurate measuring instruments. The CS-200 is a new type of colorimeter achieving high accuracy while maintaining the simple operation of tristimulus-type colorimeters.

Three selectable angles of 1° , 0.2° , and 0.1° make it easy to measure large and very small objects in a wide measuring range from low luminance of 0.01 cd/m^2 to high luminance of $20,000,000 \text{ cd/m}^2$ (with a measuring angle of 0.1°).

The CS-200 can be used for luminance and chromaticity measurement of various optical devices such as displays like LCDs, PDPs, organic ELs and FEDs, as well as light sources such as LEDs and lamps.

Accurate measurement

Konica Minolta's newly-developed spectral fitting method enables luminance and chromaticity measurement of single colors in various displays with an accuracy comparable to many spectroradiometers.

Wide measuring range from low to high luminance

- Measurement is available from a low luminance of 0.01 cd/m^2 to a high luminance of $20,000,000 \text{ cd/m}^2$ (with a measuring angle of 0.1°).
- Use of the spectral fitting method and precise analog circuitry achieves stable measurement even for low luminance.

Compact and lightweight. Battery power is also possible.

- The compact, lightweight and stylish body allows hand-held operation. The CS-200 can be operated with either four AA batteries (battery indicator function provided) or a special AC adapter.

Measurement button

Finder and Diopter adjustment ring

Objective lens and Focus adjustment ring

Hand strap

LCD screen

Power switch

Measuring angle selector

USB connector

AC adapter input terminal

Additional Functions

- Measurements can be synchronized with the display device by numerical input of the frequency.
- Selectable measurement speed (AUTO, MANU, superFAST, FAST, SLOW and superSLOW)
- Large LCD display with backlight
- USB 1.1 communication
- Data storage: 101 measured values (9-letter ID assignment possible) and 20 reference values
- User calibration: 20 channels

Selectable measuring angle


- While checking the actual subject, you can select the measuring angle easily according to the application (1° , 0.2° and 0.1°).
- The aperture mirror eliminates misalignment between the finder target and the actual measuring spot, ensuring accurate aiming.

"Spectral fitting method" for accurate luminance & chromaticity measurement.


Konica Minolta's newly-developed spectral fitting method provides tristimulus values (XYZ = red, green, blue) with significantly higher accuracy than that of conventional tristimulus colorimeters. This is achieved by using the output from 40 sensors to calculate the spectral response corresponding to human eye sensitivity (CIE 1931 color-matching functions).

The CS-200 uses 40 sensors for sensitivity covering the entire visible region and multiplies each sensor output by appropriate coefficients. This adjusts the spectral response of the instrument to close to the CIE 1931 color-matching functions.

In addition to the 2° Standard Observer, the 10° Standard Observer (for object-color measurements) can also be selected, which is impossible with conventional tristimulus colorimeters.

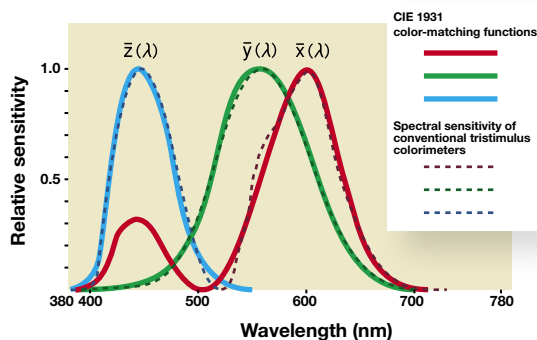

CIE 1931 color-matching functions and spectral response of a conventional tristimulus colorimeter

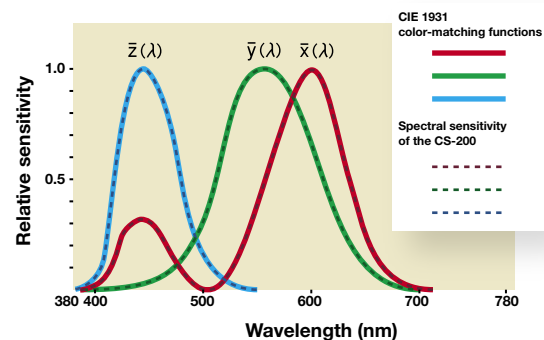

CIE 1931 color-matching functions and spectral response of the CS-200

KONICA MINOLTA's Chroma Meter for accurate light-source measurement allows building of a color management network both internally and externally.


In R&D and design departments

There is no need for calibration work to determine a value of each light source by using a reference spectroradiometer. For displays like LCDs or organic ELs in particular, user calibration for the reference panel using a spectroradiometer can be eliminated *1.

*1 If higher accuracy is required, user calibration can be used.

In quality management and incoming inspection departments


Since individual errors are minimized compared to conventional tristimulus colorimeters, the inspection of various devices such as panels does not require individual error correction.

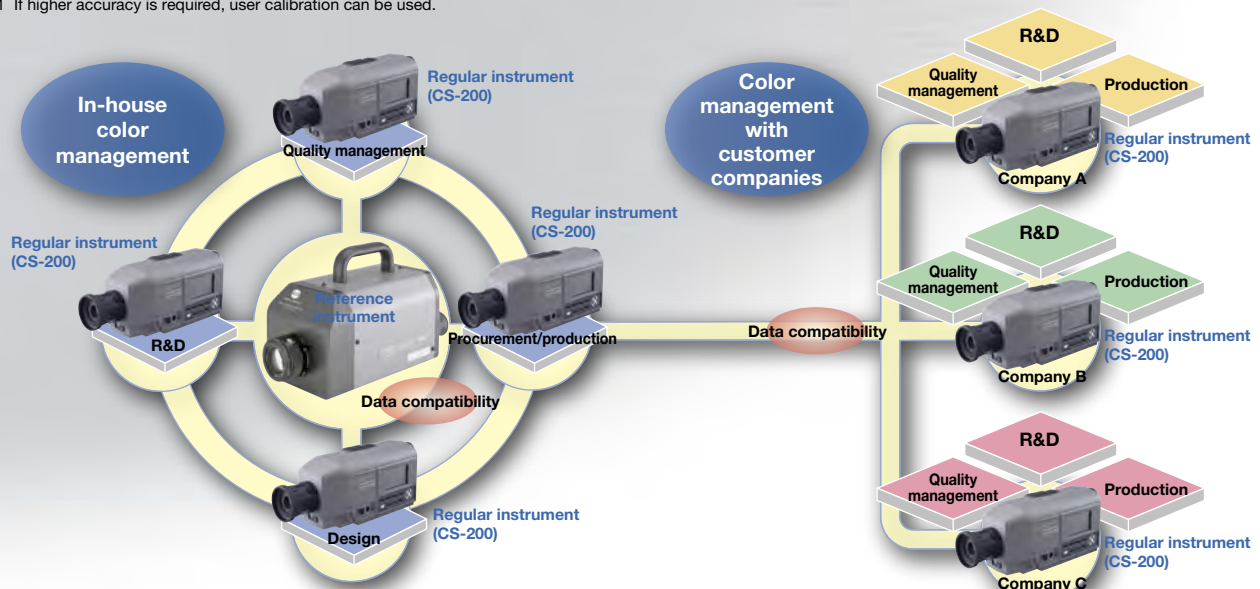




1° aperture

- For measurement of general-size areas such as medium and large displays
- LCD, PDP, or EL display panels
 - LCD panels of mobile phones or digital cameras
 - Light sources such as lamps or fluorescent-tube backlights
 - Radar or other instrument panels in aircraft cockpits
 - Large outdoor display screens

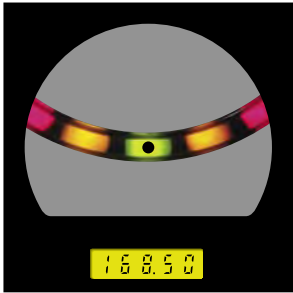

0.2° aperture

- For measurement of small areas such as product LEDs
- Sub-display of mobile phones
 - Car audio equipment
 - Automobile instrument panels

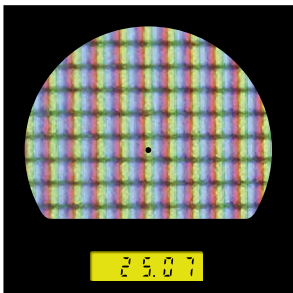

0.1° aperture

- For measurement of very small areas or of a distant light source
- Pixels of a PDP or LCD
 - Cold cathode tube
 - Automobile lamps
 - Signal lights



Evaluation applications

- Evaluation of the luminance and chromaticity of light sources
- Evaluation of luminance and chromaticity uniformity
- Contrast evaluation
- γ-characteristic evaluation
- Simple measurement of object colors
- (The optional white calibration plate is required.)



Measuring distance and measuring area


(Unit: mm)

	Minimum measuring area			Maximum measuring area			Minimum measuring distance			Maximum measuring distance			Measuring area at 500 mm			Measuring area at 1000 mm		
(Measuring angle)	1°	0.2°	0.1°	1°	0.2°	0.1°	1°	0.2°	0.1°	1°	0.2°	0.1°	1°	0.2°	0.1°	1°	0.2°	0.1°
Without a Close-Up Lens	4.7	1.0	0.5	∞	∞	∞	296			∞			φ 8.5	φ 1.7	φ 0.9	φ 17.7	φ 3.6	φ 1.8
Close-up lens No. 122	2.2	0.5	0.3	4.6	1.0	0.5	128			240			—	—	—	—	—	—
Close-up lens No. 107	0.8	0.2	0.1	1.1	0.3	0.2	43			52			—	—	—	—	—	—

* Measuring distance is the distance from the front edge of the metal lens barrel or close-up lens ring.

Data Management Software CS-S10w Standard (Standard accessory)


CS-S10w Standard Edition allows users to control the CS-200 with a PC to display the list of measured data or to transfer the data to spreadsheet software.

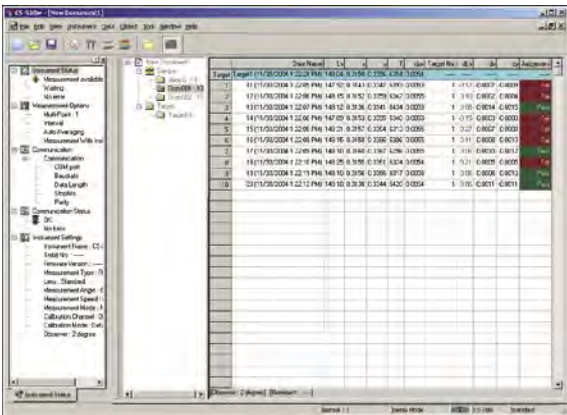

List display

<Functions common to Standard and Professional Editions>


- Color space : L_v x y, L_v u' v', $L_v T\Delta uv$
XYZ, dominant wavelength
- Mode selection : Normal mode
Object color mode
- Instrument control : Average measurement
Interval measurement
User calibration
- Data management : Reading and saving files
Data management with folders
- Data evaluation : Observer/Illuminant settings
Statistics display for each folder
Box tolerance setting

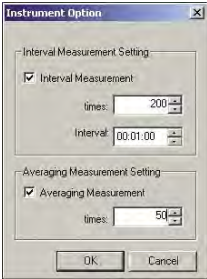


Interval and average measurements

Data Management Software CS-S10w Professional (Optional accessory)

In addition to the functions of Standard Edition, optional CS-S10w Professional Edition enables various data management, analysis and evaluation functions useful for R&D or quality control.

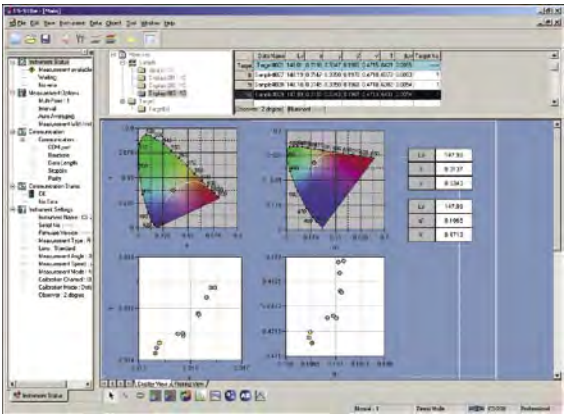


Template showing xy and u'v' chromaticity diagrams

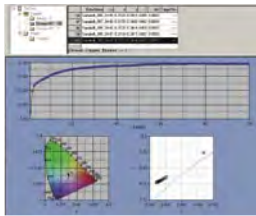


Trend graph display

<Functions available only with Professional Edition>

- Mode selection : Contrast mode
RGB mode
RGB & contrast mode
- Data management : Creating, saving and loading templates (customizable design/layouts for various graphs)
Various graph displays

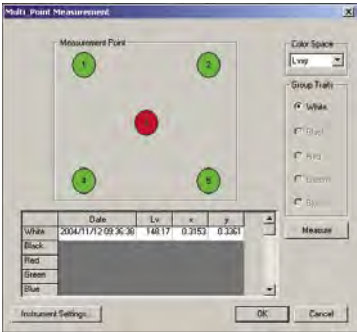

Multiple-point measurement

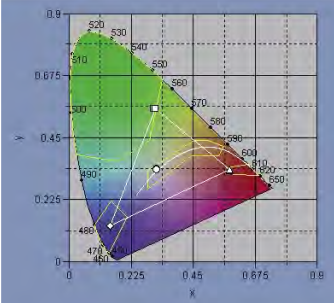

Pass/fail judgment using polygon tolerance (limit values) setting on a chromaticity diagram

- Data evaluation : Multiple-point measurement, uniformity display, contrast display and polygon tolerance setting for display evaluation
- Other : Creating reports in customizable screen layouts

Area Name	L	a	b	T	Unit	Target No
Max	148.25	0.3153	0.3361	6.395	0.0054	
Min	147.98	0.3143	0.3345	6.337	0.0053	
Mean	148.10	0.3148	0.3354	6.366	0.0054	
Std Dev	0.0240	0.0004355	0.0005680	25	0.00002963	
Non-Uniformity	0.15	0.21	0.35	0.30	5.06	
Display-001_F02	147.98	0.3143	0.3345	6.337	0.0054	
Display-001_F03	148.17	0.3153	0.3361	6.337	0.0054	
Display-001_F04	148.25	0.3147	0.3353	6.363	0.0054	
Display-001_F05	148.25	0.3147	0.3353	6.363	0.0054	

Uniformity list

System requirements (common to Standard and Professional Editions)

OS	Windows®2000 Professional SP2, Windows®XP Professional SP1
CPU	Pentium®III 600 MHz equivalent or higher (recommended)
Memory	128 MB min. (256 MB or more recommended)
Hard disk	60 MB or more space required for installation
Display	1024 X 768, 256 colors or more
Other	CD-ROM drive, USB port

• Windows® are trademarks of Microsoft Corporation in the USA and other countries.
• Pentium® is a trademarks of Intel Corporation in the USA and other countries.

CS-200 specifications

Item	CS-200
Measurement range	0.01 - 200,000 cd/m ² (Measuring angle 1°)
	0.01 - 5,000,000 cd/m ² (Measuring angle 0.2°)
	0.01 - 20,000,000 cd/m ² (Measuring angle 0.1°)
Accuracy (Measuring angle 1°) #1 (Temperature: 23°C±2°C, Relative humidity: 65% max.)	150 cd/m ² (for Illuminant A) $L_v \pm 2\% \pm 1\text{digit}$ $xy \pm 0.002$
	0.01-0.5 cd/m ² (for Illuminant A) $L_v \pm 0.02 \text{ cd/m}^2 \pm 1\text{digit}$ ---
	0.5-1 cd/m ² (for Illuminant A) $L_v \pm 0.02 \text{ cd/m}^2 \pm 1\text{digit}$ $xy \pm 0.007$
	1-10 cd/m ² (for Illuminant A) $L_v \pm 2\% \pm 1\text{digit}$ $xy \pm 0.004$
	10-200,000 cd/m ² (for Illuminant A) $L_v \pm 2\% \pm 1\text{digit}$ $xy \pm 0.003$
	5000 cd/m ² (for Illuminant A) color filter (R, G, B) $xy \pm 0.006$
Repeatability (Measuring angle 1°) #2	0.01-1 cd/m ² (for Illuminant A) $L_v \pm 0.03 \text{ cd/m}^2 \pm 1\text{digit}$ --- (2σ/SLOW)
	1-2 cd/m ² (for Illuminant A) $L_v \pm 2\% \pm 1\text{digit}$ $xy \pm 0.008$ (2σ/SLOW)
	2-4 cd/m ² (for Illuminant A) $L_v \pm 2\% \pm 1\text{digit}$ $xy \pm 0.004$ (2σ/SLOW)
	4-8 cd/m ² (for Illuminant A) $L_v \pm 2\% \pm 1\text{digit}$ $xy \pm 0.002$ (2σ/SLOW)
	8-200,000 cd/m ² (for Illuminant A) $L_v \pm 2\% \pm 1\text{digit}$ $xy \pm 0.001$ (2σ/SLOW)
	(Repeatability in Super-FAST& FAST mode is SLOW mode * 2) (Repeatability in Super-SLOW mode is SLOW mode / 2)
Measurement time	0.5 sec / meas. (Super-FAST) 1 sec / meas. (FAST) 3 sec / meas. (SLOW) 12 sec / meas. (Super-SLOW)
Measurement method	Spectral method, Grating + linear photo diode array
Measuring angle	1°, 0.2°, 0.1° (switchable)
Minimum measuring area	0.5 mm
Minimum measuring distance	0.1 mm (close up lens)
Observer	2/10 degrees
Color space	L_v x y , L_v u' v', L_v T _{Δuv} , XYZ, dominant wavelength
Measurement synchronization setting range	Vertical synchronization frequency : 40.00 to 200.00Hz
Interface	USB 1.1
Power source	AC adapter or 4 AA-Size Batteries
Battery life	Approx. 3 hours (continuous measurement / Fast mode / AA-size alkaline cells)
Size	95 mm (W) x 127 mm (H) x 330 mm (L)
Weight	1.8 kg (without battery)
Operating temperature /humidity range	0°C to 40°C, relative humidity 85% or less (at 35°C) with no condensation
Storage temperature /humidity range	0°C to 45°C, relative humidity 85% or less (at 35°C) with no condensation

#1 23°C ±2°C $L_v = 0.01-10 \text{ cd/m}^2$, SLOW, average of 30 measurements

$L_v = 10 \text{ cd/m}^2$ and higher, SLOW, average of 10 measurements

#2 At 0.2° measuring angle, the amount of received light is approx. 1/25 of that for 1°.

Therefore, the repeatability becomes the same as that for 1° with 25 times lower luminance.

At 0.1° measuring angle, the amount of received light is approx. 1/100 of that for 1°.

Therefore, the repeatability becomes the same as that for 1° with 100 times lower luminance.



* This mark indicates ISO 9001:2000-certified quality management system.


SAFETY PRECAUTIONS

For correct use and for your safety, be sure to read the instruction manual before using the instrument.




- Always connect the instrument to the specified power supply voltage. Improper connection may cause a fire or electric shock.
- Be sure to use the specified batteries. Using improper batteries may cause a fire or electric shock.

System configuration

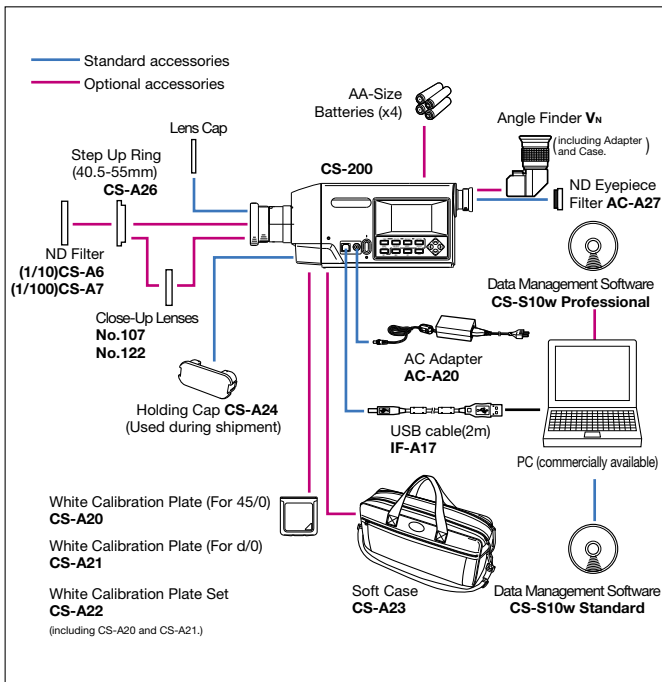

Outer dimensions (Unit: mm)

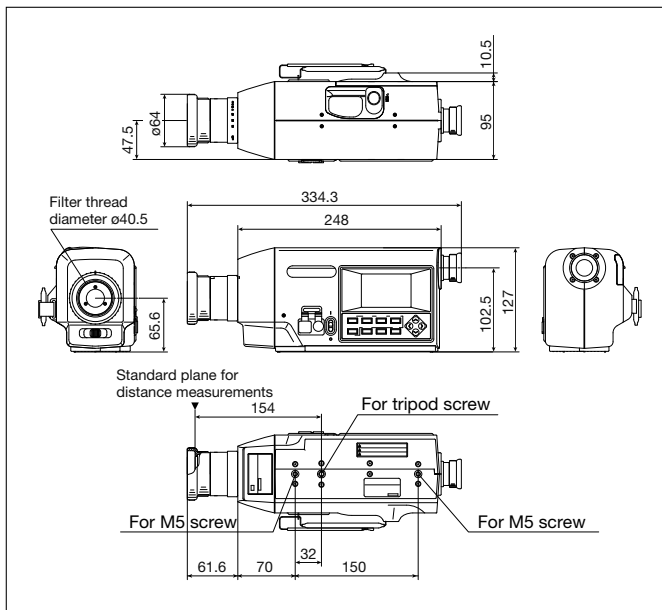

• Specifications are subject to change without notice.

Customization service:

In order to meet customer needs even more fully, Konica Minolta offers a customization service for modifying products currently being sold.

Main customization service for CS-200 :

Modification of measuring angle to 2°

Customized products will have specifications (such as accuracy and repeatability) different from those of our normal products. Please ask your nearest Konica Minolta dealer for details.

KONICA MINOLTA SENSING, INC.

Konica Minolta Photo Imaging U.S.A., Inc.
Konica Minolta Photo Imaging Canada, Inc.
Konica Minolta Photo Imaging Europe GmbH
Konica Minolta Photo Imaging France S.A.S.
Konica Minolta Photo Imaging UK Ltd.
Konica Minolta Photo Imaging Benelux B.V.
Konica Minolta Photo Imaging (Schweiz) AG
Konica Minolta Business Solutions Italia S.p.A.
Konica Minolta Photo Imaging Svenska AB
Konica Minolta Photo Imaging (HK) Ltd.

Shanghai Office

Konica Minolta Photo Imaging Asia HQ Pte Ltd.
KONICA MINOLTA SENSING, INC. Seoul Office

3-91, Daisennishimachi, Sakai.Osaka 590-8551, Japan

725 Darlington Avenue, Mahwah, NJ 07430, U.S.A. Phone: 888-473-2656 (in USA), 201-574-4000 (outside USA) FAX: 201-574-4201
1329 Meyerside Drive, Mississauga, Ontario L5T 1C9, Canada Phone: 905-670-7722 FAX: 905-795-8234
Europaallee 17, 30855 Langenhagen, Germany Phone: +49 (0)511-7404-895 FAX: +49 (0)511-7404-809
Paris Nord II, 385, rue de la Belle-Etoile, B.P. 50077, F - 95948 Roissy C.D.G. Cedex, France Phone: +33 (0)1-49 38 25 19 FAX: +33 (0)1-49 38 47 71
7-9 Tanners Drive, Blakelands North, Milton Keynes, MK14 5BU, United Kingdom Phone: +44 (0) 1908 283 939 FAX: +44 (0) 1908 618 662
Postbus 6000, 3600 HA Maarssen, The Netherlands Phone: +33 (0)30-2470860 FAX: +33 (0)30-2470861
Riedstrasse 6, 8953 Dietikon, Switzerland Phone: +41 43 322 97 40 FAX: +41 43 322 97 49
Via Stephenson 37, 20157, Milano, Italy Phone: +39 02-39011-1 FAX: +39 02-39011-219
Solna strandväg 3, P.O.Box 9058 S-17109, Solna, Sweden Phone: +46 (0)8-627-7650 FAX: +46 (0)8-627-7685
Room 1818, Sun Hung Kai Centre, 30 Harbour Road, Wanchai, Hong Kong Phone: 852-34137508 FAX: 852-34137509
Rm 1211, Ruijin Building No.205 Maoming Road (S) Shanghai 20020, China Phone: 021-64720496 FAX: 021-64720214
10, Teban Gardens Crescent, Singapore 608923 Phone: +65 6563-5533 FAX: +65 6560-9721
801, Chung-Jin Bldg., 475-22, BangBae-Dong, Seocho-ku, Seoul, Korea Phone: 02-523-9726 FAX: 02-523-9729